

Clattering noise when raising/lowering window using the front door window lifter

Topic number	LI72.10-P-073487
Version	1
Function group	72.10 - Front door
Date	8/17/21
Validity	MODEL 223 up to VIN ending in A023009.
Reason for change	

Complaint

Clattering noise when raising/lowering window using the front door window lifter; occurs when side window is at mid-way point of its travel.


Cause

When the side windows are being raised/lowered, the rear window lifter driver may come into contact with the door module wiring harness.

Remedy


1. Remove door module for front door.
2. In area "A", see Picture1, release the existing cable strap, incl. wiring harness, from the securing strip on the door module. Remove cable strap from wiring harness. Fasten new cable strap (see parts list) to wiring harness and attach to securing strip on door module. Pay particular attention to the position of the wiring harness on securing strip, see Picture 1. After fastening wiring harness, cut off excess length of cable strap.
3. In area "B", fasten wiring harness to tab on door module with a cable tie, see Picture 2. After fastening wiring harness, cut off excess length of cable strap.
4. Install door module.

Attachments

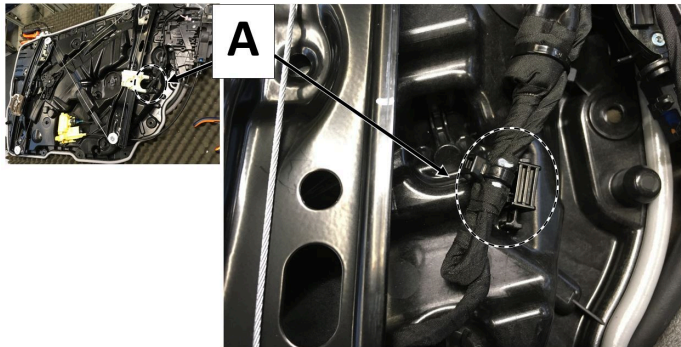File	Description
Bild 1.JPG	
	

XENTRY TIPS

Bild 2.JPG

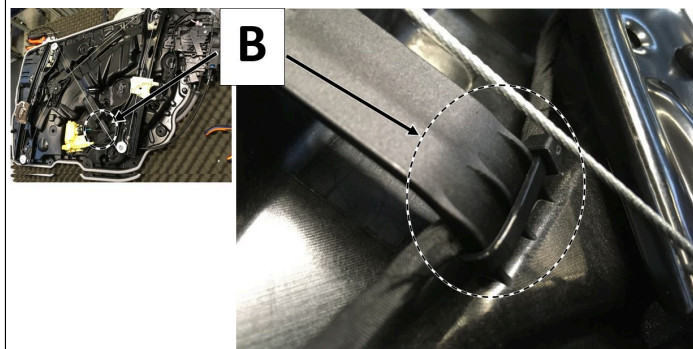

WIS-References

Document number	Title	Note
AR72.10-P-0900S	Remove/install door module	

Symptoms

Body > Glazing > Window lifting mechanism/window operation > Noise

Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 001 995 19 90			Cable strap	1		X
A 002 997 24 90	64		Cable tie	1		X

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
			72A6536	
			72N3636	