Technical Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



Subject:		
COOLANT LEAKS AT CYLINDER HEAD	Bulletin No.: 01-013/21	
	Last Issued : 12/02/2021	

BULLETIN NOTES

This bulletin supersedes the previously issued bulletin(s) listed below. The changes are noted in Red text.

Previous TSBs:	Date(s) Issued:
01-013/21	10/15/21

APPLICABLE MODEL(S)/VINS

US Spec.:

2019-2020 CX-5 SKYACTIV-G 2.5T vehicles with VINs lower than JM3KF******830243 (produced before Jun. 9, 2020) 2016-2020 CX-9 SKYACTIV-G 2.5T vehicles with VINs lower than JM3TC******422801 (produced before Jun. 9, 2020) 2018-2020 Mazda6 SKYACTIV-G 2.5T vehicles with VINs lower than JM1GL*****523967 (produced before Mar. 25, 2020)


Mexico Spec.:


2019-2020 Mazda6 SKYACTIV-G 2.5T vehicles with VINs lower than JM1GL*****523672 (produced before Mar. 21, 2020)


DESCRIPTION


Some vehicles may have coolant leaks at the cylinder head around the exhaust manifold (as shown below). There may be cracks at the stud bolt hole (1) or at the outside of the exhaust manifold (2).

Page 1 of 13

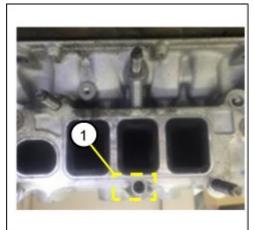

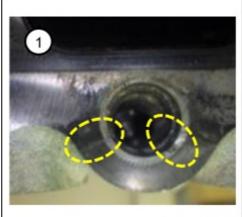

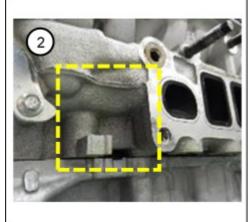

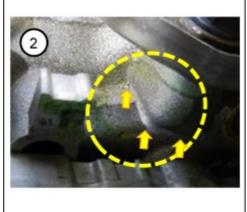

Cracks may be caused by:

- Deformation of the exhaust manifold during usage causing unexpected force to certain areas of the cylinder head.
- Residual stress generated during production in the cylinder head material may be greater than expected. The
 external force from the exhaust system when driving over bumps may cause unexpected force to certain areas of
 the cylinder head.

To eliminate this concern, the design of the exhaust manifold gasket and the cylinder head has been modified to reduce the force on the cylinder head.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

Page 2 of 13

Bulletin No.: 01-013/21 Last Issued : 12/02/2021

- 1. Verify the customer concern.
- 2. Confirm the crack(s) and coolant leak(s) are located at the area(s) shown in the "Description" above:
- If the coolant leaks are coming from other than the cylinder head itself, this Service Information is not applicable. Diagnose the leaks according to the instructions on MGSS online.
 - If the coolant leaks are coming from the area(s) shown in the "Description" above, proceed to Step 3.
- 3. Inspect for DTC P111A:
- If DTC P111A is stored in memory, engine overheating is suspected. This Service Information is not applicable. Diagnose the cause and repair, replacing the partial engine according to MGSS online. **Contact MASH for partial engine approval.**
 - If DTC P111A is not stored in memory, proceed to Step 4.
- 4. Drain some engine oil into a container.
- 5. Inspect the color of the engine oil. Is it a milky light brown color indicating coolant is mixed in with it?
 - If Yes, this Service Information is not applicable. Contact MASH for partial engine approval.
 - If No, proceed to Step 6.
- 6. Replace the cylinder head assembly with a new one using a modified exhaust manifold gasket according to the instructions on MGSS online:

NOTE: MASH approval is NOT required for cylinder head assembly replacement.

- CX-5: CYLINDER HEAD GASKET REPLACEMENT [SKYACTIV-G 2.5T]
- CX-9: CYLINDER HEAD GASKET REPLACEMENT [SKYACTIV-G 2.5T]
- Mazda6: CYLINDER HEAD GASKET REPLACEMENT [SKYACTIV-G 2.5T]

NOTE: Reuse the water outlet, fuel distributor, fuel injectors, OCV oil filter, rocker arms, HLA, CMP sensors and engine hanger brackets.

- 7. Perform "Engine Oil Data Reset" according to the instructions on MGSS online:
 - CX-5: ENGINE OIL DATA RESET [SKYACTIV-G 2.5T]
 - CX-9: ENGINE OIL DATA RESET [SKYACTIV-G 2.5T]
 - Mazda6: ENGINE OIL DATA RESET [SKYACTIV-G 2.5T]
- 8. Verify the repair.

PARTS INFORMATION

Parts Number	Description	Qty.	Notes
PYY1-10-SJ0A	HEAD SET, CYLINDER	1	
PYY1-10-S50	GASKET KIT A	1	
PYY1-13-S50	GASKET KIT B	1	

Page 3 of 13


PYY1-13-SRZ	GASKET KIT C	1	
PYY1-13-W8Z	GASKET KIT D	1	


Dealers can now utilize the Limited Parts Ordering (LPO) page on eMDCS to order the repair parts for 2.5L (with cylinder deactivation) and 2.5L turbo cylinder head repairs. There is no longer a need to contact hotline for part ordering. If there are any questions on part ordering or part status, contact the DAG group for assistance.

NOTE: It is necessary to order Gasket Kit A, B, C & D for each vehicle repair.

Non-reusable parts locations:


- · Gasket for cylinder head cover
- · Gaskets for EGR cooler and EGR valve component

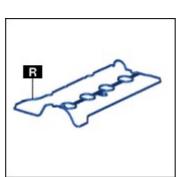

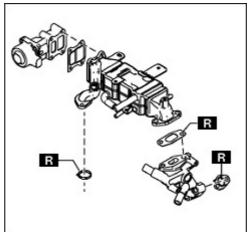


Gaskets for intake-air system

Page 4 of 13

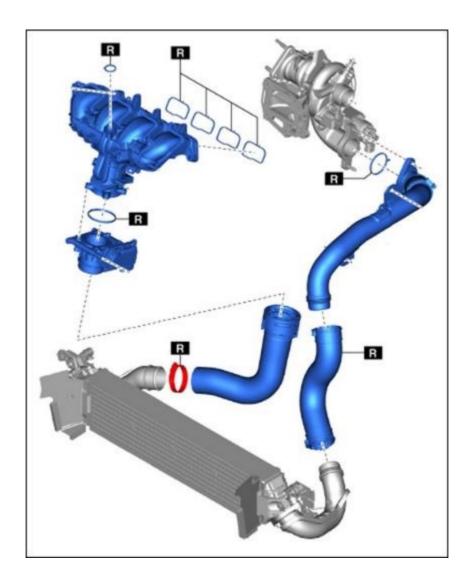


· Gasket and nuts for TWC

Page **5** of **13**

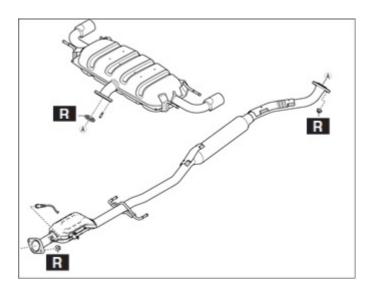


· Joint bolt A for Intermediate shaft

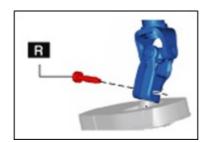


- · Snap pin for Tie-rod end
- · Lock nut for Driveshaft
- Clip for Drive shaft (LH)
- Grease (L2Y1-33-247) for knuckle

Page 6 of 13

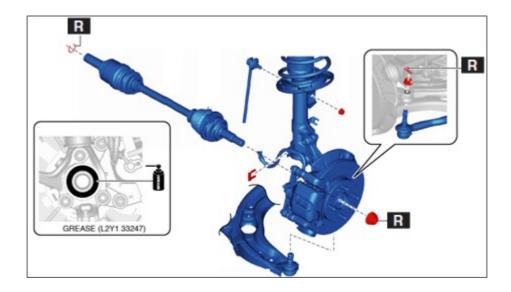



• Transfer oil seals (RH) [4WD]

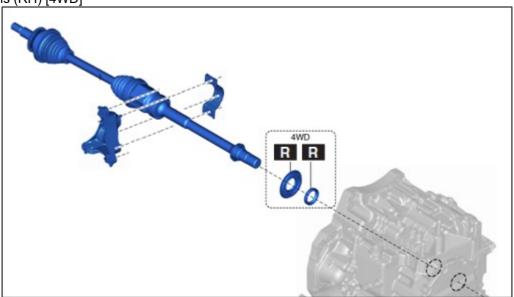


- Gasket and nuts for WU-TWC
- · Gasket and nuts for exhaust manifold

Page **7** of **13**

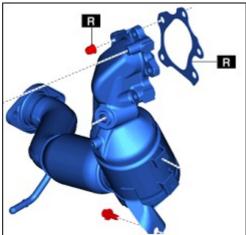

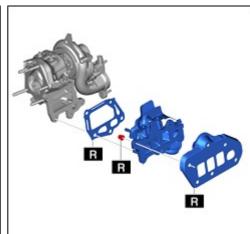


• Gaskets for turbocharger

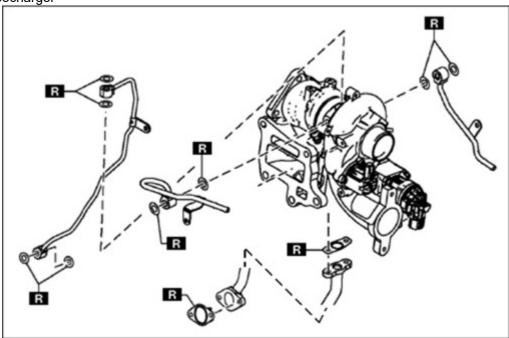


• O-ring for vacuum pump

Page **8** of **13**

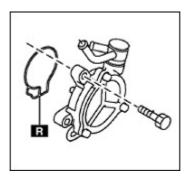


· Gaskets and pipe for high pressure fuel pump

Bulletin No.: 01-013/21

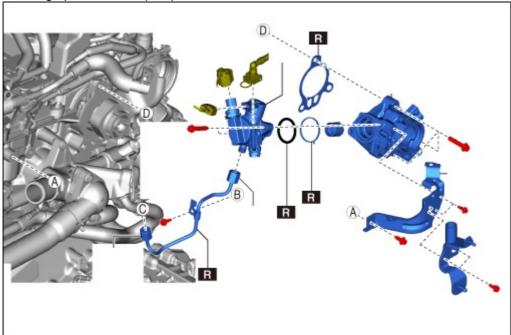



· Gasket and O-rings for water pipes and cylinder head gasket

Page 9 of 13

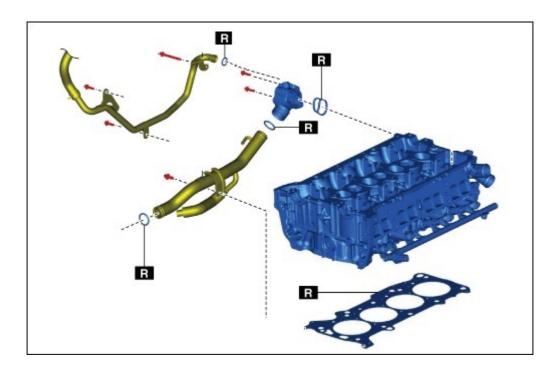


- · Gasket for water outlet
- O-ring for electric variable valve timing motor/driver
- · Sealing washer for bolt
- Front oil seal

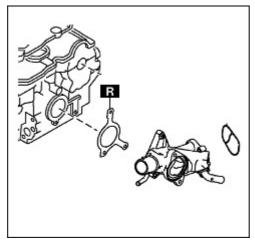


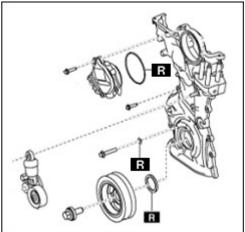


- · Spacer and O-rings for fuel injector
- O-rings for CMP sensor

Page **10** of **13**

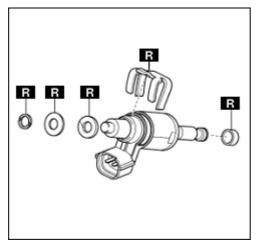


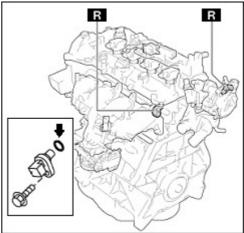

· Pressure detection square head plug

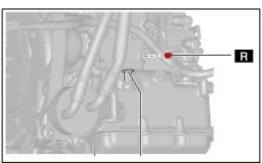

NOTE: For information only, DO NOT order the parts shown below. They are already included with the Cylinder Head Set (PYY1-10-SJ0).

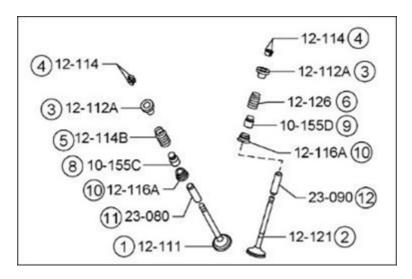

Page **11** of **13**

Bulletin No.: 01-013/21	Last Issued : 12/02/2021
-------------------------	--------------------------

No.	Description	Qty.
1	VALVE, INLET	8
2	VALVE, EXHAUST	8
3	SEAT, VALVE SPG-UP	16
4	COTTER, VALVE	32
5	SPRING, VALVE	8
6	SPRING, OUTER-EX. VALVE	8
8	SEAL, INLET VALVE	8
9	SEAL, EXHAUST VALVE	8
10	SEAT, VALVE SPGLWR	16
11	GUIDE, VALVE	8
12	GUIDE, VALVE	8

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's Powertrain Warranty.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	Α
Symptom Code	77
Damage Code	9A
Part Number Main Cause	PYY1-10-SJ0
Quantity	1
Operation Number / Labor Hours:	XXS82BRX / 11.2 Hr. (CX-5 2WD) XXS82CRX / 11.1 Hr. (CX-5 4WD) XXS82ARX / 11.3 Hr. (CX-9) XXS82ARX / 10.9 Hr. (Mazda6)

NOTE:

- Claim engine oil (5.9 L {6.2 US qt, 5.2 Imp qt} maximum), ATF (4.9 L {5.1 US qt, 4.3 Imp qt} maximum), gear oil (0.45 L {0.48 US qt, 0.40 Imp qt} maximum) and coolant (9.9 L {10.5 US qt, 8.7 Imp qt} maximum) as related parts.
- If Wheel Alignment Check and Adjust is performed at outside shop, claim the actual invoice amount with sublet code "C1".

Page 12 of 13

Bulletin No.: 01-013/21 Last Issued : 12/02/2021

Page 13 of 13