

TECHNICAL TOPICS

ELECTRICAL



Near Field Sensing feature degradation (Surround camera; 360 Park Aid) with PIVI B115E-31 DTC	2020-2022 Defender, 2021-2022 Discovery, Discovery Sport, Evoque, Velar, XF, E-Pace, F-Pace, I-Pace
<p>Issue:</p> <ul style="list-style-type: none">– Surround camera; 360 Park Aid features or any of the feature is not operating. NFSM DTCs are not logged in confirmed/active status, only PIVI B115E-31 in confirmed status <p>Cause:</p> <ul style="list-style-type: none">– Currently Under Investigation <p>Action:</p> <ul style="list-style-type: none">– Do not replace the NFSM for this issue <p>Before disturbing any components</p> <ul style="list-style-type: none">– Please ensure PIVI campaign 3.0.0 has been completed & Update NFSM module using Pathfinder, to their respective latest available levels.– Note: NFSM is not on SOTA, PathFinder only– Submit a TA if the issue persists <p>Land Rover SSM75618, and Jaguar SSM75617 have been published</p>	

