

## SRS DTC U3000-49 Internal Failure of the SRS Unit

### AFFECTED VEHICLES

Year	Model	Trim Level
2020–21	Accord	ALL
2020–21	Civic	ALL
2020–21	Clarity	ALL
2020–21	CR-V	ALL
2020	Fit	ALL
2020–21	HR-V	ALL
2020–21	Insight	ALL
2020–21	Odyssey	ALL
2020–21	Passport	ALL
2020–21	Pilot	ALL
2020–21	Ridgeline	ALL

**EDITOR'S NOTE:** This article revises the previous version posted in January 2022.

There are several possible causes for the SRS DTC U3000-49 (Internal Failure of the SRS Unit) to be stored. If you can duplicate the DTC, the troubleshooting will take you through the step-by-step process in isolating the faulty component. In most situations, the SRS Unit should be last on the list of components to replace. Here is a quick tip for troubleshooting a faulty seat weight sensor.

Disconnect all of the seat weight sensors and clear the DTCs. If DTC U3000-49 (Internal Failure of the SRS Unit) does not reappear then replace the seat frame/rail.

**NOTE:** If you are using a seat frame from a known good vehicle, always find a vehicle with the same trim level. Swapping seat frames with different trim levels may result in the same DTC condition and cause confusion.