



## Mack Chassis - Granite Models (GU, GR) - Revised Fan Ring Design; Engine Cooling Fan Ring Cracked At Welds - Model Years 2016 To 2020



> Internal Content

Affected date ranges: 2 June 2014 (W1423) - 24 June 2019 (W1921)

A new fan ring design has been released to address the vibration. The revised fan rings have been designed with a larger rubber seal that contacts the fan shroud and is able to effectively dampen vibration of the ring.

Part numbers for the new fan ring design can be found below:

Old Part Number	New Part Number	Description
22516648	23496866	Fan Ring for 710 Millimeter fan
22516651	23496867	Fan Ring for 750 Millimeter fan

Please refer to the illustrations below to verify the fan ring seal has been installed correctly.




### Correct Setting of the Fan Ring Seal

The seal should be outside of the shroud





**Correct** - Fan Ring Seal sits on the outside of the shroud

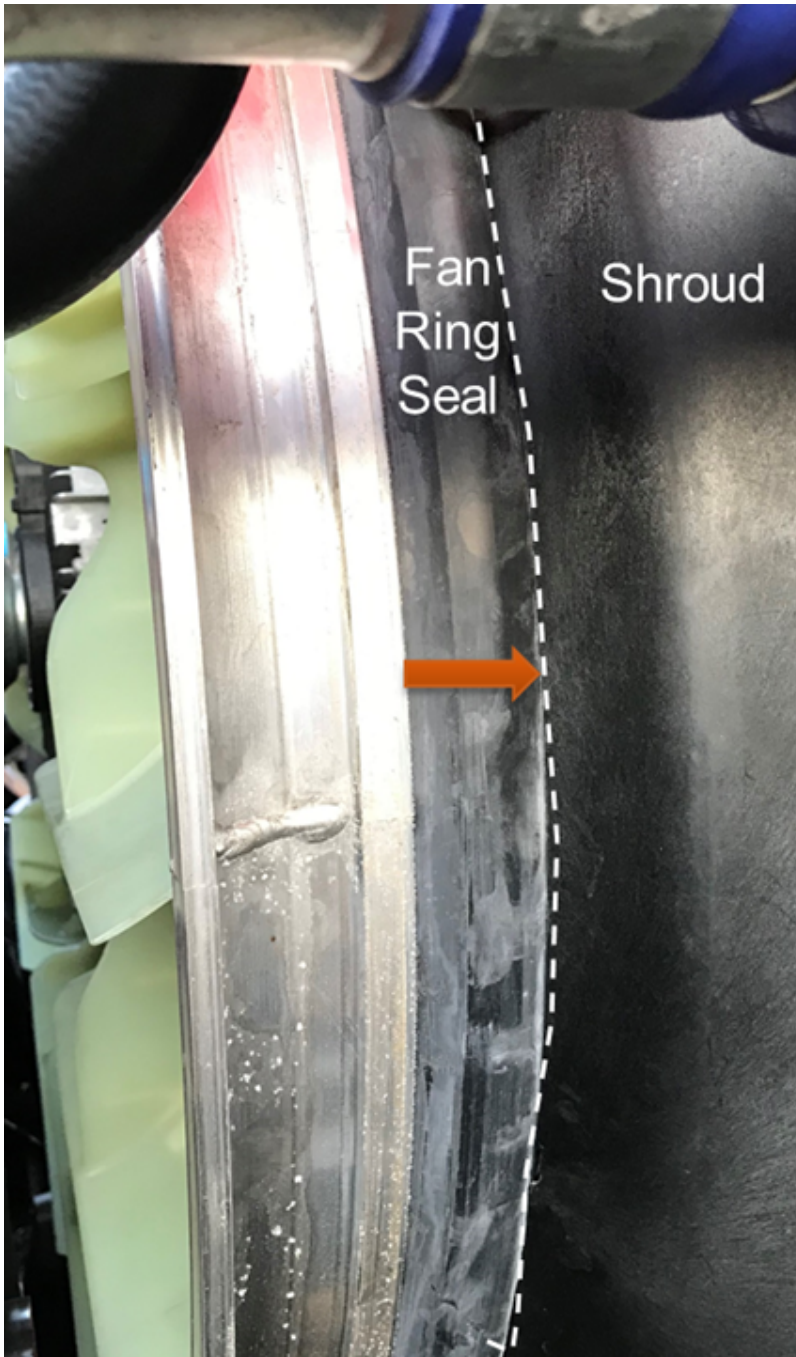

**Incorrect** - Fan Ring Seal is tucked INSIDE of the shroud causing it to look short in length. Be sure to check all the way around the shroud for mis-set seal



Tags

[mack](#)

[fan shroud](#)

### Related links and attachments

No links or attachments available



### Feedback

[Give feedback](#)

to help improve the content of this article