



Technical Service Bulletin

91 MIB2 High: Assigned steering wheel button for Drive Select is lost

91 22 67 2053258/2 January 18, 2022. Supersedes Technical Service Bulletin Group 91 number 18-23 dated December 13, 2018 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3, A3 Cabriolet, A3 e-tron, S3, R S3, A4, A4 allroad, and S4	2017 – 2018	All	With Audi Drive Select and MIB2 High
A5, A5 Sportback, S5 Cabriolet, S5 Sportback, Q5, and SQ5	2018	All	With Audi Drive Select and MIB2 High

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised Service (Updated SVM Code) Revised Required Parts and Tools (Updated SD Card part number)
1	12/13/2018	Initial publication

Customer states:

- The customer states that the assigned function of the programmable steering wheel button (star) for Drive Select is sporadically lost (Figure 1).



Technical Service Bulletin

- The customer assigns “Drive Select” to the steering wheel button in the MMI, which initially works.
- However, after a certain amount of time, it is lost and the steering wheel button does revert to being unassigned.



Figure 1. Steering wheel assignable button for Drive Select.

Technical Background

The MIB2 software needs to be updated.

Production Solution

New infotainment software was introduced into MY19.

Service

Required equipment:

- ODIS Tester
- SVM code
- MIB2 High Software update on SD Card (See *Required Parts and Tools* or Download the software from MirrorServer using the SD Creator Program)

Time to complete update:

- Approximately 30-60 minutes (includes 20-50 minutes for the software update and 10 minutes for the SVM work)

Service work:

Update the MIB2 High infotainment system using either Method 1 or Method 2 according to TSB 2047576: *91 MIB2 High Software Update Instructions (PR Code 7UG)* and use SVM code indicated below:



Technical Service Bulletin

Vehicle	SD Creator Part Number	SVM Code
A4, A5, Q5, and Q7	4M0 906 961 BN	MHI2QUS5087
A3	8V0 906 961 AN	MHI2US5512

Method 1: Automated update using ODIS

Method 2: Manual update due to SVM code or Server issues

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9196		
Damage Code:	0039		
Labor Operations:	Software Update	0151 0000	According to TSB 2047576
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
Claim Comment:	As per TSB 2053258		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



Technical Service Bulletin

Required Parts and Tools

Part Number	Part Description	Quantity
4M0906961BN	A4, A5, Q5, and Q7 MMI software update (SD Card) – Or download via SD creator Software	01 (Shop tool)
8V0906961AN	A3 MMI software update (SD Card) – Or download via SD creator Software	01 (Shop tool)

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2047576: *91 MIB2 High Navigation Software Update Instructions (PR Code 7UG).*
- TSB 2047812: *00 SD Creator: How to setup and use the SD Creator for obtaining vehicle software updates via the MirrorServer.*

All part and service references provided in this TSB (2053258) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2022 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.