



Service Information

Offboard Diagnostic Information System Service (ODIS Service)

Number: VOS-22-03

Subject: Software Version Update, Enhancements and Fixes

Date: Jan. 19, 2022

Supersedes VOS-21-53 due to new diagnostic content

The following ODIS Service software versions are available for download.

Current ODIS Service Software Versions	
Application: V9.0.1	Diagnostic Content: V2.44.0

Key Fixes/Enhancements for Diagnostic Content: V2.44.0:

1. BU - Jetta 2018 – 2021

B201000: no basic setting and B135454: Seat height adjustment motor no basic setting

J810_X_1_0614_11_Grundeinstellung_00000 malfunctions.

- Basic setting for the seat height adjustment not performed.

2. E2/E3 - ID.4 2021

Passenger Occupant Detection System Control Module -J706- calibration

J706_X_1_0819_11_Grundeinstellung_00011 malfunction.

- During the control module scan, it was determined that this vehicle is not equipped with the following component: Passenger Occupant Detection System Control Module -J706-.

3. CA/CM Atlas 2018 – 2021

B116229: Selector lever park position lock switch Range/Performance

F319_X_1_0913_11_BCM_UDS_00011 malfunctions.

- Test step Read measuring value: Selector Lever Park Position Lock Switch - F319 malfunctions.
- Do not operate the following component: Selector lever.
- Specified value: Not engaged and not locked.

4. 5K - Golf 2010 - 2014

P0474: Exhaust Pressure Sensor "A" Circuit Intermittent/Erratic is active/static in the ECM, but no test is created in Test Plans for the fault code.

(cont.)



Service Information

5. 7P - Touareg 2010 – 2017, CGRA 3.6 LFSI / 206kW

VAG01856: Right Front Seat Temperature Sensor G345_7P_72____1_1109_11_00011 incorrect component test for VIN.

- VIN is equipped with PR code 4A3 heated seats and 4D0 non-ventilated seat, equipped with G60 front passenger heated seat temp sensor and not G345 Temperature sender for front right seat.

6. CL - Taos 2022

P064F00: Unauthorized Software/Calibration Detected

SYS_X_1_0317_11_X_X_MSG_XX_FSB_Motorsteuergeraet_00000 still active/static after ECM replacement.

- Test ends with "Replace the following component: Engine/Motor Control Module - J623". ECM has already been replaced.

7. 16 - Jetta 2011 – 2018, CJAA 2.0 L TDI CR / 103 kW

P2271: O2 Sensor Signal Stuck Rich; Bank 1 Sensor 2 G130_5K_23CJAA_1_0609_66_00011 incorrect specified voltage at T6ao between pins 2 and 6.

- Voltage measurement has been eliminated from test.

8. CA/CM Atlas 2018 – 2021

P030000: Random/Multiple Cylinder Misfire Detected and P030400: Cyl.4 Misfire Detected
SYS_X_1_0616_11_X_X_VAU_OT_FSB_Aussetzer_00000 malfunction.

- Test step: Performing basic setting - Note the following boundary conditions: Malfunction
- Reason for cancellation: Malfunction

9. General translation errors.