

**Macan (PA) GTS – Check Engine Warning for Lean Fuel Mixture Error(s)**

**Vehicles Affected**

Models	Model Year	Model Type	VIN Range	Vehicle-Specific Equipment
Macan	2020	95BBL1	N/A	N/A

**Revision History**

Revision	Release Date	Changes
0	March 5, 2021	Original document
1	January 10, 2022	Update of Model Year

**Condition**

Active instrument cluster faults for engine control warnings (00A016) occur in the wake of DME error entries **P0174(1)00\_004083(1AB)- 'Mixture formation, bank 2(1) – too lean.'** One or both of these errors are possible. Furthermore, these faults occur commonly under the following engine and environmental conditions:

- Low RPM ( $\leq 2000$  1/min)
- Closely approaching, or already warm engine and oil temperatures ( $\approx 90$  °C water;  $> 40$  °C oil )Low to mid 'calculated' engine load (20-50%)
- Vehicle Speed  $< 100$  km/h (60 mph)
- In the majority of occurrences, the diagnostic responsible for the fault occurs at an altitude of approximately 4500 feet, corresponding to an ambient air pressure of 861 mbar.

**Technical Background**

The diagnostic responsible for these faults is under analysis. If at least four of the five aforementioned conditions from the fault's environmental data exist, then consider the vehicle to exhibit this diagnostic phenomenon.

**Additional Information**

Porsche is aware of this fault and actively investigating it. There is no indication this diagnostic error is damaging to the vehicle. Though less likely, this fault can reoccur, but there is no need to alter driving habits.

### Service Information

After recording a Vehicle Analysis Log (VAL), delete the fault memory log and drive to ensure there are no further errors. If a vehicle exhibits the diagnostic error described herein, there is no need to replace any parts at this time. As soon as more information and a means for resolution is available, this bulletin will update accordingly.

### Warranty

As always, please document the case completely in PQIS.

Use the following troubleshooting labor operation:

03350000     On board diagnostic (Main work) Fault memory read out  
03350053     On board diagnostic (Composite) VAL

For this repair, please code the "cause" as follows:

Cause location:            24700     DME control unit  
Cause symptom:            4028     Reacts to Faults

### Search Items

95BBL1; 95B.II; P017400\_004083; P017100\_0041AB- 'Mixture formation, bank 2, bank 1 – too lean';  
Macan PA –GTS , 2.9 liter V6 bi-turbo; fuel trim; altitude

---

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

---