

# **Technical Service Bulletin**

SUBJECT:			No:	TSB-22-52A-001REV
NOISE FROM FRONT SEAT BACK - REVISED			DATE:	January 2022
			MODEL: See Below	
CIRCULATE TO:	[] GENERAL MANAGER	[ X ] PARTS MANAGER		[ X ] TECHNICIAN
[ X ] SERVICE ADVISOR	[ X ] SERVICE MANAGER	[] WARRANTY PROCESSO	R	[] SALES MANAGER

This bulletin supersedes TSB-20-52A-002, issued October 2020 to add **2011-12 and 2016-2022 Outlander Sport / RVR** models. Revisions are italicized and indicated by

### PURPOSE

A customer may report a condition where an abnormal rubbing noise is heard from the Seat Back when a driver and/or passenger is seated in the front seat(s). This may occur due to Nonwoven Fabric Tape being improperly attached during the production process, causing direct contact between the Seat Frame and Urethane Pad. As a result, an abnormal rubbing noise may be heard.

This TSB instructs dealers to apply Nonwoven Fabric Tape between the Seat Back and Urethane Pad.

#### AFFECTED VEHICLES

- ALL Outlander
- ALL Outlander PHEV
- 2011-12 and 2016-2022 Outlander Sport / RVR

#### REPAIR PROCEDURE

Attach Nonwoven Fabric behind the Seat Back Urethane Pad by referring to the steps illustrated below.


For removal and installation of Front Seat and Seat Back Urethane Pad, refer to the Workshop Manual.

Copyright 2022, Mitsubishi Motors North America, Inc.

The information contained in this bulletin is subject to change. For the latest version of this document, go to the Mitsubishi Dealer Link, MEDIC, or the Mitsubishi Service Information website (www.mitsubishitechinfo.com).

No	Attach Nonwoven Fabric Tape to the Urethane Pad Side				
1	Prepare Nonwoven Fabric Tape According to the illustration:	Nonwoven fabric tape: 6979A696 Tape ©:65mm×240mm Tape ©:65mm×90mm			
2	Remove Seat Back Pad from the Seat As Manual.	sembly by referring to the Service			
3	Attach tape following the illustration and information below: <right-left direction=""> Align the center of the pad groove with Tape<sup>®</sup> center of short side (65mm) (Reference dimensions) The tape side is about 60mm from the center of the back material hole along the pad surface <up-down direction=""> Align 10 mm from bottom back surface of the pad groove with tape <sup>®</sup> bottom edge of long side (240 mm).</up-down></right-left>	Inner side Outer side This photo shows the back RH side of seat. **For vehicles with side airbag specification; DO NOT attach the tape to the outer side. **Attach the tape to LH side. LH and RH tape should be symmetrical. Right-left direction Tape ① Of the pad groove Up-down direction The center of the pad groove			

Outer side
<ul> <li>Indicates RH side</li> <li>Seen from the back of pad</li> </ul>
reassemble the Seat Back Pad.

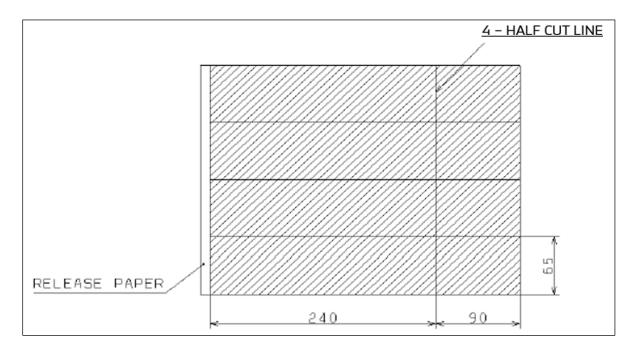

## PARTS INFORMATION

Order only the Genuine Mitsubishi Part listed below.

Model	Part Name	Part Number	Quantity	]
Outlander				
Outlander PHEV	Nonwoven Fabric Tape	6979A696	1	◀
<i>Outlander</i> <i>Sport / RVR</i>				

#### WARRANTY INFORMATION

This bulletin is supplied as technical information only and is not an authorization to repair. If an affected vehicle is reported with the described condition, diagnose the condition, repair as described in this bulletin and submit a normal warranty claim using the following information.

Labor Operation Code	Operation	Quantity	Failure Code	Cause Code	Time Allowance
521133BU	1 seat	1	80Z	480	1.0 hrs
521133BV	2 seats	1	80Z	480	1.6 hrs

Warranty Coverage: 5/60 Basic Coverage (Canada: 5/100)