

SSM 50472 - 2021-2022 Bronco - 2.3L - Illuminated Brake Warning Lamp And/Or Brake System Warning Message – DTC P050F Set In The ABS Module And Firm Brake Pedal

Some 2021-2022 Bronco vehicles equipped with the 2.3L engine may exhibit a red brake warning lamp and/or brake system warning message in the instrument panel cluster (IPC) with a diagnostic trouble code (DTC) P050F in the anti-lock brake system (ABS) module and a firm brake pedal. This may be due to contamination in a brake booster vacuum line. To correct this condition, replace the vehicle's vacuum hose (MB3Z-2420-A). Refer to Workshop Manual (WSM), Section 206-09 for installation instructions. For claiming, use casual part 2420.

APPLICABLE VEHICLES

2021 - 2022 TRUCK: G1 U725N BRONCO