

Published date: 01/25/2022

Preliminary Information

PIT5821B Passenger I/P Airbag Assembly Parts Restriction

Models

Brand:	Model:	Model Years:	VIN:		Engino	Transmissions:
			from	to	Engine:	Halisillissions.
Cadillac	Escalade Models	2007 - 2014	All	All	All	All
Chevrolet	Avalanche	2007 - 2013	All	All	All	All
Chevrolet	Silverado 1500	2007 - 2013	All	All	All	All
Chevrolet	Suburban	2007 - 2014	All	All	All	All
Chevrolet	Tahoe	2007 - 2014	All	All	All	All
GMC	Sierra 1500	2007 - 2013	All	All	All	All
GMC	Yukon Models	2007 - 2014	All	All	All	All

Involved Region or Country	North America
Condition	Some passenger I/P Air Bag assemblies were built without an inflator. Because of this, these passenger I/P Air Bag assemblies have been placed on a parts restriction, see list below.
Cause	Parts source change.

Correction:

Dealerships are to determine which passenger I/P Air Bag assembly is needed for their vehicle. If it is one of the restricted Air Bags from the provided list below then contact the Technical Assistance Center (TAC) per the instructions below. In addition, the dealership must order and install inflator PN 84304240 into the new passenger I/P Air Bag assembly. This work must be done by the dealership and a warranty claim must be submitted for this work, per the instructions below.

U. S. Dealers: Please contact TAC by opening a new case via Dealer Case Management (DCM) from the DCM home page and request the needed part p/n, as well as, the reason for replacement. Example; SI diagnostic, collision repair, etc. ALL parts request required a VIN.

Canada Dealers: Please contact TAC by calling and request the needed part p/n, as well as, the reason for replacement. Example; SI diagnostic, Collision repair, etc. ALL parts request required a VIN.

Note: ALL orders MUST have a VIN entered into the TAC case, even over-the-counter parts sales to an independent body shop or a customer. In addition to that, any over-the-counter parts sales MUST have the inflator installed into the air bag assembly by the dealership BEFORE the part is given to the customer.


Dealerships will receive an Air Bag assembly that does not include the inflator. The dealership will need to order inflator PN 84304240 in addition to the air bag assembly. The dealership is required to install the inflator PN 84304240 into the new air bag assembly prior to the part being installed in vehicle. The dealership is to follow the repair procedure outlined on the instruction sheet included in the kit.

The dealership will be required to record the serial number off the new inflator being installed into the Air Bag assembly, see example photos below. The serial number will then be recorded in the repair order for proper

documentation.

If the old air bag assembly, removed from the vehicle, was NOT deployed then do NOT deploy it. Return the undeployed air bag using the return shipping instructions located with the new inflator PN 84304240.

If the old Air Bag assembly, removed from the vehicle, was already deployed then dispose of the deployed air bag through normal refuse channels.

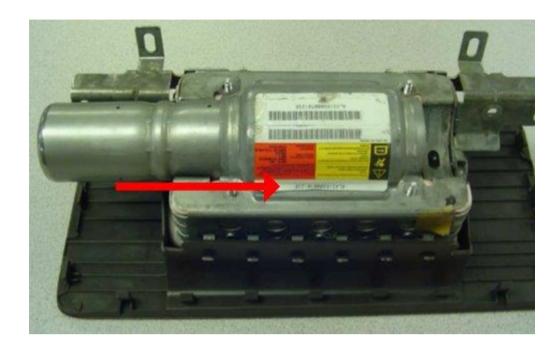



Parts Information

Part Number	Description	
* 85526051	AIRBAG ASM-I/P	
* 85526052	AIRBAG ASM-I/P	
85526054	AIRBAG ASM-I/P	
85526057	AIRBAG ASM-I/P	
85526060	AIRBAG ASM-I/P	
*Additional Ordering Instructions Required. Please Inspect the Passenger Airbag cover for reuse before		
contacting TAC.		

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time	Trans. Type
6486108	Install New Inflator (PN 84304240) into the New Air Bag Asm	0.3 Hr.	ZFAT

<u>Version History</u>

Version	3
	04/29/2021 - Created on.
Modified	07/26/2021 - Updates to Parts information section when ordering part
Modified	numbers 85526051 or 85526052.
	01/24/2022 - Updates to the parts information section



 $\hbox{@ 2022 General Motors.}$ All Rights Reserved.