

SSM 50505 - 2022 F-Super Duty - XL/XLT Trim - Trailer Tire Status Monitor Capability Not Detected - Built On Or Before 07-Feb-2022

Some 2022 F-Super Duty vehicles equipped with XL or XLT trim and built on or before 07-Feb-2022 may exhibit a Trailer Tire Status Monitor Capability Not Detected message in the Trailer Tire Info section of the instrument panel cluster (IPC) while a configured trailer is attached. If the vehicle is equipped with a Dealer Installed Accessory or Genuine Ford Accessory trailer tire pressure monitoring system (TPMS), part numbers LC3Z-1A189-A/B/D/E, this may be due to the gateway module (GWM) configuration. To correct the condition, download and run the GWM - Gateway Module A (GWM) Configuration application using the Ford Diagnosis and Repair System (FDRS). For claiming, use causal part 14F642 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.

APPLICABLE VEHICLES
2022 TRUCK: FE P558N SUPER DUTY