

# Technical Service Bulletin

#### 91 MIB2 High: lowering volume for the parking system does not work

91 22 88 2060475/2 March 7, 2022. Supersedes Technical Service Bulletin Group 91 number 20-99 dated August 21, 2020, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, S6, A7, S7, and RS 7	2015 – 2018	All	MIB2 High

### Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised header (detailed vehicle filter) Revised Service (added second SVM code for some vehicles)
1	08/21/2020	Initial publication

#### **Customer states:**

- A short time after the parking aid is activated, there is no audio instead of the pre-selected lowered volume in the parking aid menu.
- When the parking aid deactivates, the regular volume resumes.

# **Technical Background**

Not applicable.

## **Production Solution**

A new infotainment cluster 10 update addressed the condition.

## **Service**

#### **SVM Update Instructions**

- 1. Follow all instructions in TSB 2047576: 91 MIB2 High Software Update Instructions (PR Code 7UG).
- 2. Update the infotainment system using the SVM action code as listed in the table below, if necessary:



# Technical Service Bulletin

Vehicles with a production date before calendar week 22/2016

Vehicle SD Creator Part number		SVM code	
A6/A7	4M0906961DB	MHI2US0541	
A6/A7	4M0906961DK	91U7C027	



It is crucial to run the second SVM code stated in the above flash table after running the first SVM code.

Vehicles with a production date on or after calendar week 22/2016

Vehicle	SD Creator Part number	SVM code
A6/A7	4M0906961DC	MHI2US3341



Vehicles with a production date on or after calendar week 22/2016 do not need to run SVM 91U7C027.

## **Warranty**

Claim Type:	• 110 up to 48 Months/50,000 Miles.		
Ciaiiii Typoi	1 TO up to 46 Months/50,000 Miles.		
	G10 for CPO Covered Vehicles – Verify Owner.		
	If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9196		
Damage Code:	0039		
Labor Operations:	Software Update (Includes checking for DTCs)	0151 0000	As per TSB# 2047576
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB 2060475/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



# Technical Service Bulletin

## **Required Parts and Tools**

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Model	SD Card	Quantity
A6/A7 (Prior to 22/2016)	4M0906961DB	01 (Shop tool)
A6/A7 (Prior to 22/2016)	4M0906961DK	01 (Shop tool)
A6/A7 (On or after 22/2016)	4M0906961DC	01 (Shop tool)

### **Additional Information**

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

• TSB 2047576: 91 MIB2 High Software Update Instructions (PR Code 7UG).

All part and service references provided in this TSB (2060475) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2022 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.