



19-22-01 - Coolant Fill Improvements

Release date: 3/3/2022

Condition

Applicable Vehicles					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Atlas	2018 - 2022	All	All	All	All
Atlas Cross Sport	2020 – 2022	All	All	All	All

Revision Table			
Instance Number	Published Date	Version Number	Reason For Update
2066380/1	3/3/22	19-22-01	Original publication.

Customer complaint of coolant light on or low coolant level in expansion tank without visible leaks.

Technical Background

Customer complaint of coolant light on or low coolant level in expansion tank without visible leaks.

Production Solution

Improved coolant fill process implemented in production at vehicle factory.

Service

Before replacing any cooling system related parts, including but not limited to, coolant pump, thermostat, head gasket, coolant hoses/lines, or seals; the vehicle must be pressure tested according to ELSA instruction and inspected to verify an actual coolant leak exists.

If no internal or external leaks are identified during the pressure test, then it is likely the cooling system contained an air pocket during the initial fill that that has now escaped. Do not replace any parts for this condition.

Warranty

Information only.



19-22-01 - Coolant Fill Improvements

Release date: 3/3/2022

Required Parts and Tools

No Special Parts required.

Tool Description	Tool No:
Cooling System Tester	VAG1274B
Cooling System Tester Adapter	VAG1274/8
Cooling System Tester Adapter	VAG1274/9

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.