



Bulletin No.: PIP5840

Published date: N/A

Preliminary Information

PIP5840 Modify Sound Insulator During Service

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade models	2021 - 2022	All	All	LM2	All
Chevrolet	Silverado	2020 - 2022	All	All	LM2	All
Chevrolet	Suburban	2021 - 2022	All	All	LM2	All
Chevrolet	Tahoe	2021 - 2022	All	All	LM2	All
GMC	Sierra	2020 - 2022	All	All	LM2	All
GMC	Yukon models	2021 - 2022	All	All	LM2	All

Involved Region or Country:	North America
Condition:	When performing any service that requires removal of the engine cover.
Cause:	Due to the potential of a "stand off" causing strain on electrical circuits, modify the camshaft housing cover insulator as described below.

Correction:

Whether reinstalling the original camshaft housing cover insulator or a new one, modify it by cutting off the stand off identified in the pictures below.



Note how the standoff made contact and added stress to the the circuit.



A wide angle view for orientation.



Cut the standoff flush with the surrounding area.

Warranty Information

For vehicles repaired under warranty, use the published Labor Operation for the actual repair being performed and add .2 Hrs straight time for standoff removal.

Version History

Version	1
Modified	02/25/2022 - Created on.

