



Technical Service Bulletin

66 Rear spoiler is inoperative

66 22 85 2065220/2 March 10, 2022. Supersedes Technical Service Bulletin Group 66 number 21-79 dated December 7, 2021 for reasons listed below.


Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A7 and S7	2019 – 2021	All	Not Applicable
	2022	000001 – 016175	Not Applicable
RS 7	2021	All	Not Applicable
	2022	900000 – 901415	Not Applicable
e-tron GT	2022	000001 – 005302	Not Applicable
RS e-tron GT	2022	900000 – 902735	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised header (Add A7, S7 and RS7) Revised <i>Warranty</i> (Add SRTs for A7, S7 and RS7)
1	12/08/2021	Initial publication

Customer states:

- The message “Rear spoiler: Malfunction!” appears in the driver’s information system (DIS) of the instrument cluster (Figure 1)
- Rear spoiler operation may not be possible.

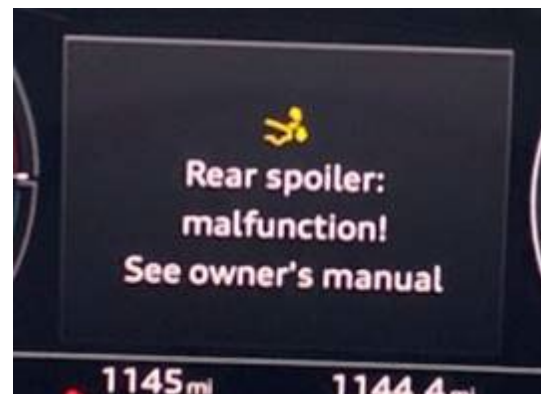



Technical Service Bulletin

Figure 1. Message in the driver's information system.

Workshop findings:

- In some cases the rear spoiler is not operative either automatically or manually. In some cases the rear spoiler system is fully operative.

One or both of the following DTC(s) may be stored in the aerodynamic control module, J223 (address word 006B):

- **DTC B18AC13** (Motor for rear spoiler drive 1, Open circuit).
- **DTC B16F8F1** (Rear spoiler drive 1, Blocking when extending).

Technical Background

Due to insufficient pressure of the carbon brushes to the motor commutator in the spoiler drive motor a loss of contact may occur and cause intermittent or permanent loss of spoiler operation.

Figure 2 shows the spoiler drive motor area of brush to commutator contact.

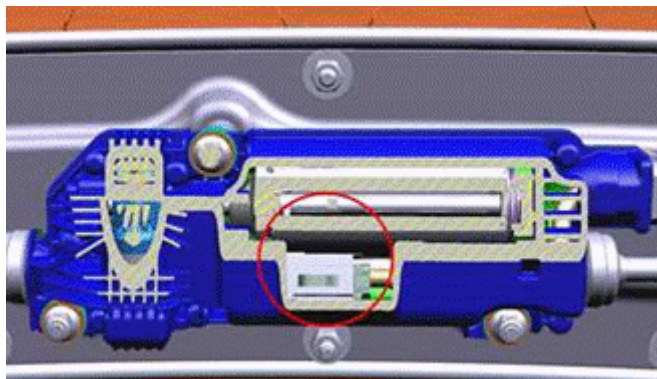


Figure 2. Cutaway view of the motor brush to commutator area.

Production Solution

The rear spoiler drive motor has been redesigned. An increase in brush to commutator pressure has been implemented in production.



Technical Service Bulletin

Service

1. Should the vehicle exhibit the symptom profile described in this TSB, replace the rear spoiler drive unit. Figure 3 shows the rear spoiler drive assembly.

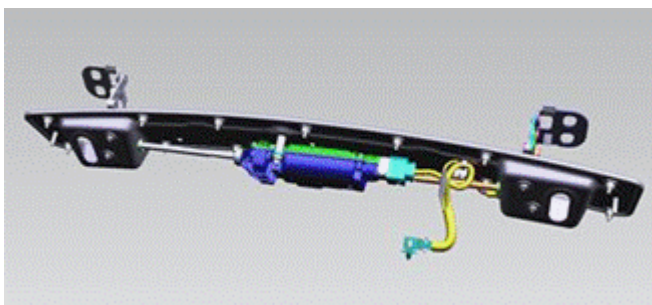


Figure 3. Rear spoiler drive assembly.

2. Complete the ODIS test plan and clear DTC(s).

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 miles.• G10 for CPO Covered Vehicles – Verify owner.• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	6672		
Damage Code:	0040		
Labor Operations:	A7, S7, RS7:		
	Tailgate trim panel remove and reinstall	7092 1900	See SRT with associated operations
	Spoiler drive remove and reinstall	6658 1951	See SRT with associated operations
	e-tron GT, RS e-tron GT:		



Technical Service Bulletin

	Tailgate trim panel remove and reinstall	7092 1900	See SRT with associated operations
	Spoiler drive remove and reinstall	6672 1900	See SRT with associated operations
Diagnostic Time:	GFF	0150 0000	Time stated on the diagnostic protocol (Max 50 TU)
	Road test prior to the service procedure	0121 0002	10 TU
	Road test after the service procedure	0121 0004	10 TU
Claim Comment:	As per TSB 2065220/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.


Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.

Part Number	Part Description	Quantity
-------------	------------------	----------



Technical Service Bulletin

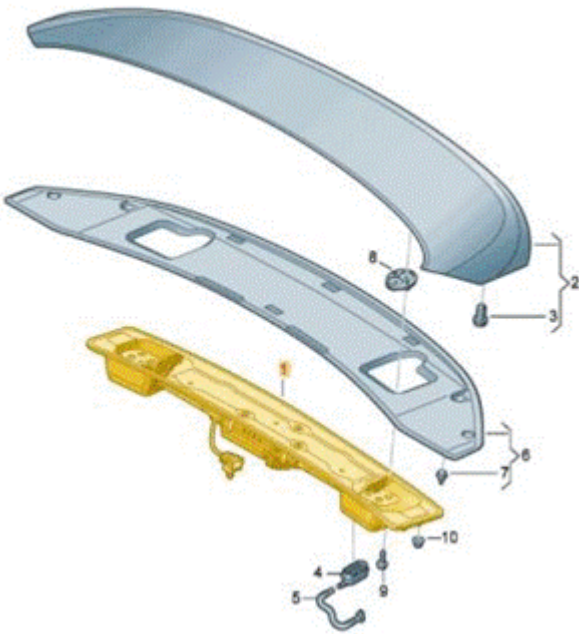4K8827948F	 <p>Bracket for spoiler drive unit</p>	01
------------	--	----

Additional Information

All parts and service references provided in this TSB (2065220) are subject to change and/or removal.

©2022 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.