



Technical Service Bulletin

46 Parking brake motor malfunction - DTC C10BD01 and/or C10BC01

46 22 29 2066568/1 March 21, 2022.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q5, and SQ5	2019 – 2021	All	Not Applicable
Q5 e quattro	2020 – 2021		

Condition

Customer states:

Parking brake malfunction message displayed in the instrument cluster.

Workshop findings:

The following DTCs may be stored in the ABS control unit J104, (address word 0003).

DTC C10BD01 Right parking brake motor electrical error, and/or:

DTC C10BC01 Left parking brake motor electrical error.

Technical Background

Not applicable.

Production Solution

Not applicable.

Service

Proceed as follows:

1. Replace the rear caliper assembly together with parking brake motor (V282 and/or V283) according to:
ELSA>>*Repair Manual*>>*Chassis*>>*Brake Systems*>>*Rear Brake*>>*Parking Brake*.
1. Do not separate the parking brake motor from the caliper.



Technical Service Bulletin

2. Install new parts and proceed with all necessary steps according to ELSA/GFF.
3. Release the vehicle.

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	4663		
Damage Code:	0040		
Labor Operations:	Rear brake carrier remove + reinstall	4615 1950	See SRT
	Rear brake carriers remove + reinstall	4615 2050	See SRT
Diagnostic Time:	GFF	0150 0000	Time stated on the diagnostic protocol (Max 40 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB 2066568/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.



Technical Service Bulletin

Part Number	Part Description	Quantity
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA
See ETKA	Brake caliper housing with servomotor	01/02

Additional Information

All parts and service references provided in this TSB (2066568) are subject to change and/or removal.

©2022 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.