



SERVICE BULLETIN

SER22-021
4/14/2022


SUBJECT: APU Electrical Outlet Harness

The outlet harness that connects at the CCU board (JP1) will need to be inspected during installation to ensure that it is wired correctly. This inspection will be needed on 200INT, 210STA and 230SKY models from serial number UVU91685542 to VVB91707624.

If a harness is identified as being wired incorrectly, order part number 30-753-01K from PPG. Installation of the incorrectly wired harness may cause an electrical shock to the technician and/or operator.

A Field Action Claim can be entered in WebClaim 2.0, referencing R-992. Option 1 will pay a \$20 flat charge for completing the inspection. If the harness is found to be incorrect, select Option 2 which will reimburse the part and an additional 0.1 hour in labor will be provided to change the part. Identified serial numbers are preloaded in WebClaim 2.0. The harness will be on mandatory part return (MPR).

The below diagram identifies which colors go to corresponding terminals at the CCU board.

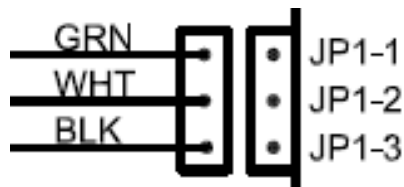

The below pictures identify correct and incorrect wiring of the JP1 plug.



Correct



Incorrect