



# TECHNICAL TOPICS

## BODY/CHASSIS



<p>Power Steering Assistance Reduced Message Displayed</p>	<p>20-22MY Defender 21-22MY Discovery</p>
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none"> <li>A customer may report that “Power Steering Reduced” message displays on the message center on start-up with a reduction in steering assist.</li> </ul> <p><u>Technical Description:</u></p> <ul style="list-style-type: none"> <li>This may be caused by voltage dipping to low to the Power Steering Control Module (PSCM) during start-up.</li> </ul> <p><u>Status:</u></p> <ul style="list-style-type: none"> <li>Revised PSCM software has been created to address this concern and was released on PATHFINDER version 367.</li> <li>SSM75704 has been published to address this concern.</li> <li>Most 21MY and all 22MY vehicles can be updated using TOPIx Cloud.</li> <li>For 20MY and some 21MY vehicles a TA case may need to be submitted to obtain a Manual Patch file for PATHFINDER, until TOPIx Cloud is updated to cover PSCM programming on those models.</li> </ul>	  <p><b>PATHFINDER</b> </p> <p><b>JOIN THE JOURNEY</b></p>

