



SERVICE BULLETIN

**SB-22-007 2020MY CONVENTIONAL DTC P0005
AND/OR P20DE, P24A1, P24A2**

**GROUP: 22-FUEL SYSTEM
BULLETIN NO: SB-22-007
DATE: 4-14-2022**

Subject: Certain 2020MY Conventional trucks equipped with an J08 engine.

Note: This technical service bulletin is covered under 2 year base or 5y/100k mile emissions warranty.

OVERVIEW:

20MY Conventional trucks equipped with a bubbler filter 23304-EV460 may set Diagnostic Trouble Codes (DTC's) P20DE and/or P0005, P24A1, P24A2 under some conditions. If a truck comes into your location exhibiting these DTC's and is equipped with the 23304-EV460 bubbler filter, replace the filter with 23304-EV023.

Note: It is also recommended that any unit in for a maintenance bubbler fuel filter replacement equipped with the 23304-EV460 filter be changed over to the 23304-EV023 filter. Hino part numbers will be superseded to reflect this change in the future.



FINAL INSPECTION PROCEDURE

1. To complete this Technical Service Bulletin, review the bulletin and confirm the following:
 - Using Hino DX2, ensure all codes have been cleared from the module prior to releasing the truck back to the customer.

CLAIM APPLICATION

Reimbursable in accordance within the terms and policies of the Hino limited warranties.

Bubbler Filter Inspection/Replacement:

- a) Labor charge: 0.5 Hour
- b) Warranty code: 06312
- c) Trouble code: 40
- d) Operation code: 06301HRE
- e) Original failed part: 23304EV460

