



# Service Bulletin

Bulletin No.: 22-NA-046

Date: May, 2022

## TECHNICAL

**Subject: Service Front Camera message on the Driver Information Center (DIC)**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Silverado 1500	2021	2021				
	Silverado 1500 (LTD) (RPO J21, VIN 12th Digit = 4 or less)	2022	2022	3GCUY9EF6MG461281 (Silao) 1GCPYBEK7MZ4 30400 (Fort Wayne)	3GTU9FEL1NG170061 (Silao) 1GCUYGED5NZ178052 (Fort Wayne)		
	Silverado 2500HD/3500HD	2021		1GT49ME77NF129023 (Flint) 2GC4YNEY9N1100020 (Oshawa)	1GT49REY9NF207761 (Flint) 2GC4YMEY6N1204832 (Oshawa)		
GMC	Sierra 1500	2021	2021				
	Sierra 1500 (Limited) (RPO J21, VIN 12th Digit = 4 or less)	2022	2022	3GCUY9EF6MG461281 (Silao) 1GCPYBEK7MZ430400 (Fort Wayne)	3GTU9FEL1NG170061 (Silao) 1GCUYGED5NZ178052 (Fort Wayne)		
	Sierra 2500HD/3500HD	2021		1GT49ME77NF129023 (Flint) 2GC4YNEY9N1100020 (Oshawa)	1GT49REY9NF207761 (Flint) 2GC4YMEY6N1204832 (Oshawa)		

<b>Involved Region or Country</b>	United States, Canada, Mexico, Middle East, Israel, Palestine, Argentina (Mercosur), Chile (West), Colombia (West), Ecuador (West), Paraguay (West), Uruguay (West), Cadillac Korea (South Korea), Thailand (ASEAN), Australia/New Zealand
<b>Additional Options (RPOs)</b>	
<b>Condition</b>	<p>Some customers may comment on a "Service Front Camera" message in the DIC. Technician may find DTCs U026A, U216A may be set in history.</p> <p>This condition may occur when the radio is powered on while the vehicle is in sleep mode. Customers may also notice certain features related to the Front Camera are unavailable for use when this "Service Front Camera" message is displayed:</p> <ul style="list-style-type: none"> <li>• Front Collision Alert (RPO: UEU)</li> <li>• Following Distance Indicator (RPO: UE4)</li> <li>• Low Speed Collision Mitigation Braking (RPO: UHY)</li> <li>• Pedestrian Collision Mitigation Braking (RPO: UKJ)</li> <li>• Lane Keep Assist (RPO: UHX) 1500 LD only</li> <li>• Automatic High Beam Assist (RPO: TQ5)</li> <li>• Vision Based Adaptive Cruise Control (RPO: KSG) 1500 LD only</li> </ul>
<b>Cause</b>	The cause of the condition may be a software anomaly in the Front Camera Module.
<b>Correction</b>	Dealers are to reprogram the Front Camera Module with latest released software.

## Service Procedure


**Caution:** Before downloading the update files, be sure the computer is connected to the internet through a network cable (hardwired). DO NOT DOWNLOAD or install the files wirelessly. If there is an interruption during programming, programming failure or control module damage may occur.

- Ensure the programming tool is equipped with the latest software and is securely connected to the data link connector. If there is an interruption during programming, programming failure or control module damage may occur.
- Stable battery voltage is critical during programming. Any fluctuation, spiking, over voltage or loss of voltage will interrupt programming. Install a GM Authorized Programming Support Tool to maintain system voltage. Refer to [www.gmdesolutions.com](http://www.gmdesolutions.com) for further information. If not available, connect a fully charged 12 V jumper or booster pack disconnected from the AC voltage supply. DO NOT connect a battery charger.
- Follow the on-screen prompts regarding ignition power mode, but ensure that anything that drains excessive power (exterior lights, HVAC blower motor, etc) is off.
- Please verify that the radio time and date are set correctly before inserting USB drive into vehicle for programming, otherwise an error will result.
- Clear DTCs after programming is complete. Clearing powertrain DTCs will set the Inspection/Maintenance (I/M) system status indicators to NO.

**Important:** The service technician always needs to verify that the VIN displayed in the TLC left side drop down menu and the top center window match the VIN plate of the vehicle to be programmed prior to using Service Programming System 2 (SPS2) for programming or reprogramming a module.


- For the TLC application, service technicians need to always ensure that the power mode (ignition) is "ON" before reading the VIN from the vehicle's VIN master module and that they do not select a VIN that is already in the TLC application memory from a previous vehicle.
- If the VIN that shows up in the TLC top center window after correctly reading the VIN from the vehicle does not match the VIN plate of the vehicle, manually type in the VIN characters from the vehicle VIN plate into the TLC top center window and use these for programming or reprogramming the subject module with the correct vehicle VIN and software and/or calibrations.
- The Engine Control Module (ECM) is the master module (for VIP vehicles) that TLC reads to determine the VIN of the vehicle. If the VIN read from the vehicle by TLC does not match the VIN plate of the vehicle, the ECM also needs to be reprogrammed with the correct VIN, software and calibrations that match the vehicle's VIN plate.
- The Body Control Module (BCM) is the master module (for GEM vehicles) that TLC reads to determine the VIN of the vehicle. If the VIN read from the vehicle by TLC does not match the VIN plate of the vehicle, the BCM also needs to be reprogrammed with the correct VIN, software and calibrations that match the vehicle's VIN plate.

**Caution:** Be sure the VIN selected in the drop down menu (1) is the same as the vehicle connected (2) before beginning programming.

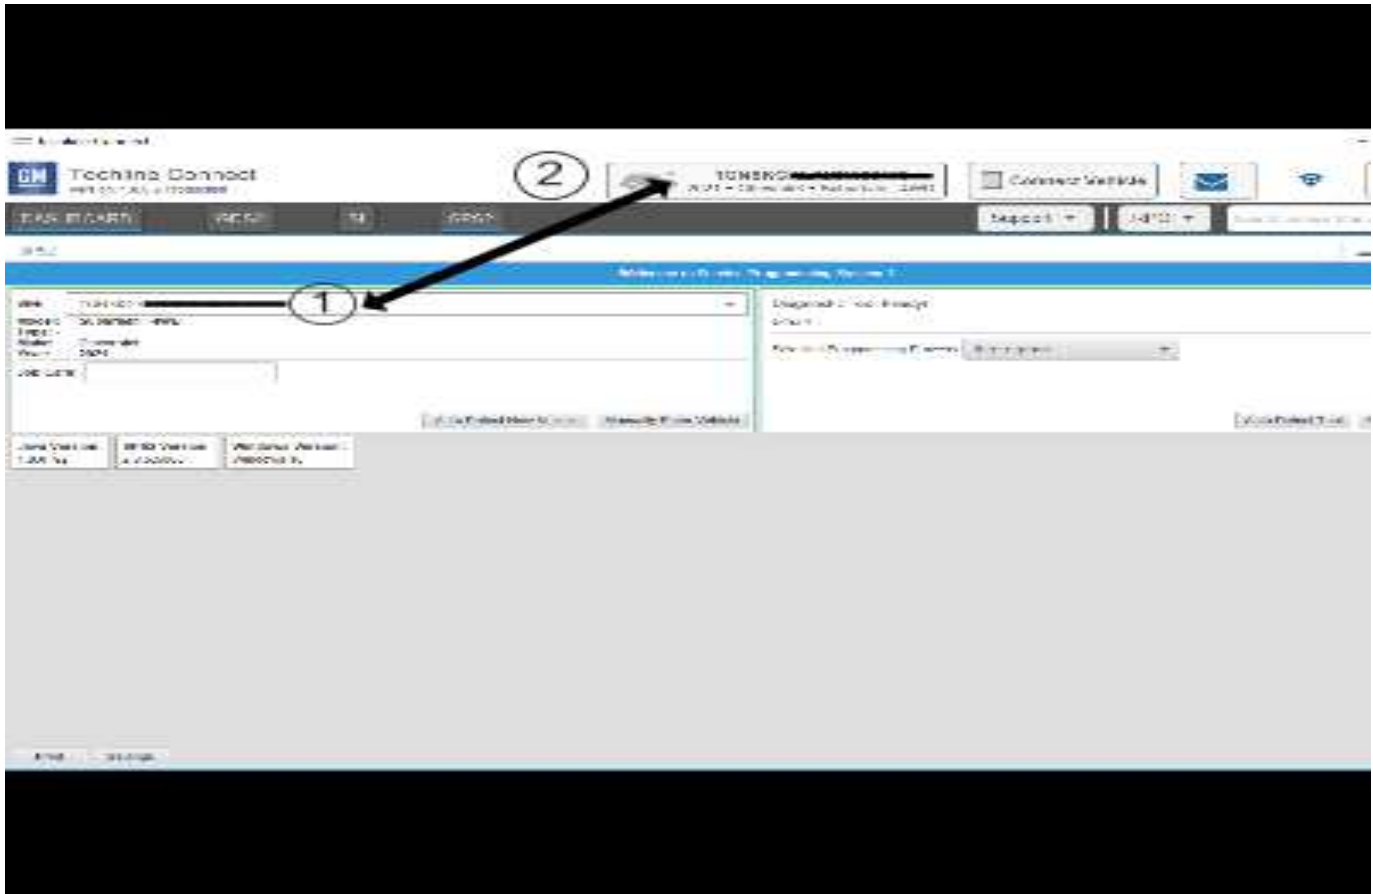


5743643

**Important:** If the vehicle VIN DOES NOT match, the message below will be shown

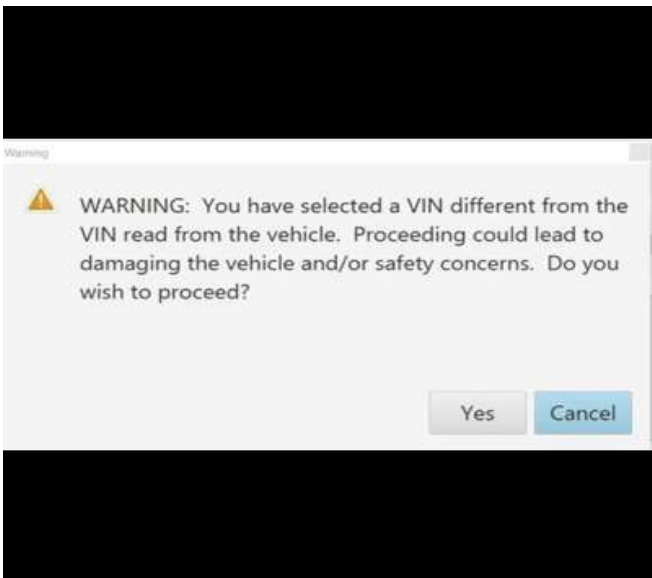

5877000

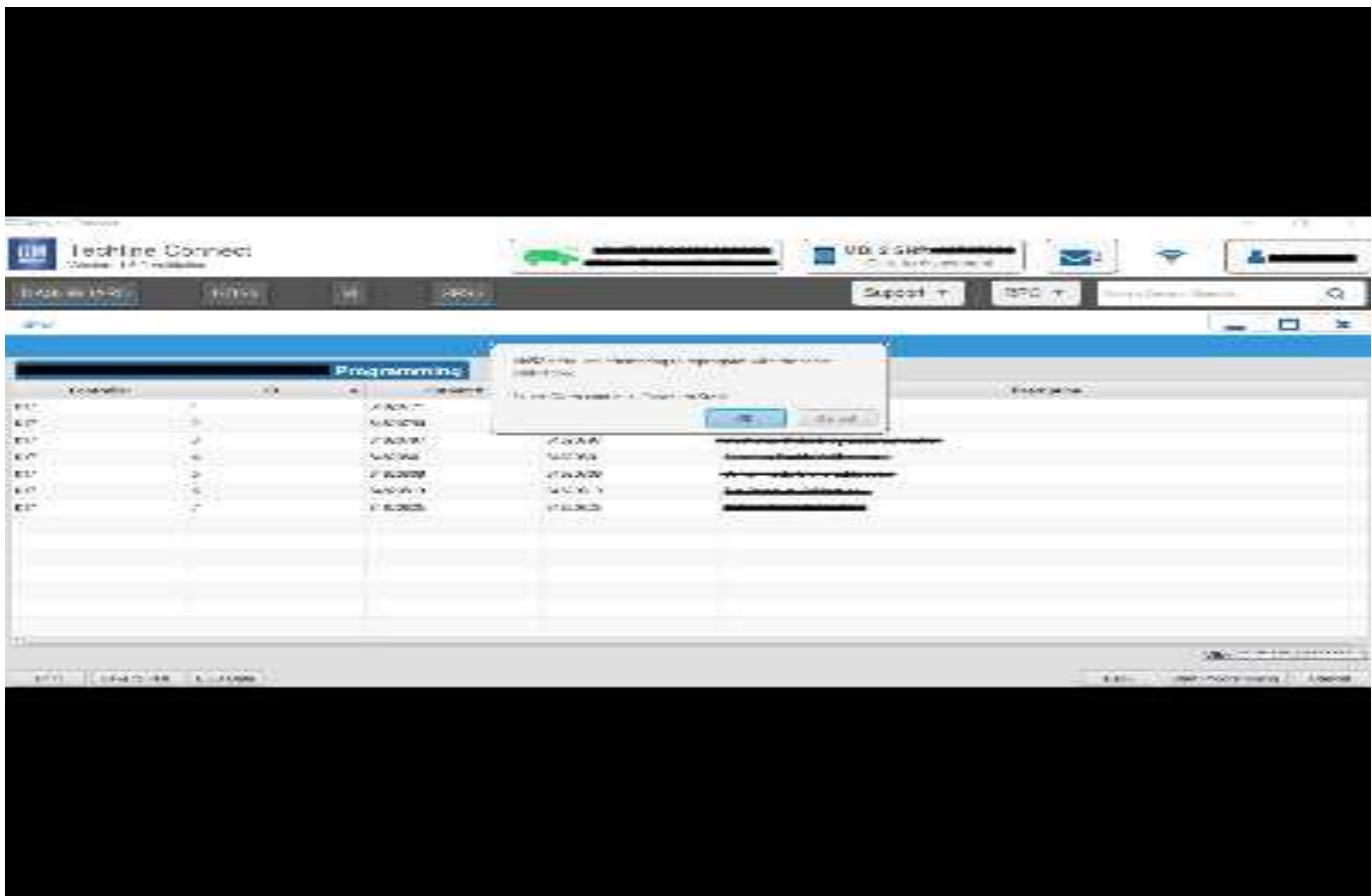



5644477

**Important:** Techline Connect screens shown above.

**Important:** If the same calibration/software warning is noted on the TLC Summary screen, select OK and follow screen instructions. After a successful programming event, the WCC is located in the Service

Programming System dialogue box of the SPS Summary screen. No further action is required. Refer to the Warranty section of the bulletin.

 1. Reprogram the Front Camera Module. Refer to *K109 Frontview Camera Module: Programming and Setup* in SI.

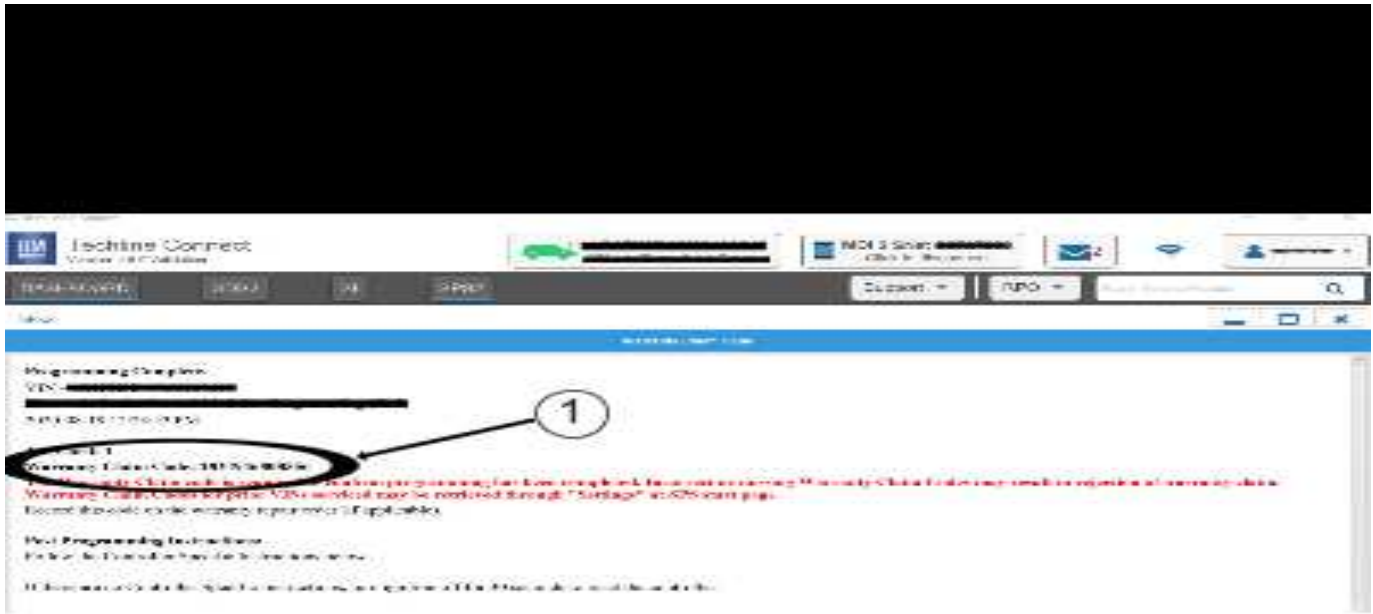

5644478

**Note:** The screenshot above is an example of module programming and may not be indicative of the specific module that is being programmed. Module selection and VIN information have been blacked out.

**Important:** To avoid warranty transaction rejections, you **MUST** record the warranty claim code provided on the Warranty Claim Code (WCC) screen shown above on the job card. Refer to callout 1 above for the location of the WCC on the screen.

2. Record SPS Warranty Claim Code on job card for warranty transaction submission.

## Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
*2888478	Reprogram Frontview Camera Module for Service Front Camera Message	0.5 hr

\*This is a unique Labor Operation for Bulletin use only.

**Important:** \*\*To avoid warranty transaction rejections, carefully read and follow the instructions below:

- The Warranty Claim Code must be accurately entered in the "SPS Warranty Claim Code" field of the transaction.
- When more than one Warranty Claim Code is generated for a programming event, it is required to document all Warranty Claim Codes in the "Correction" field on the job card. Dealers must also enter one of the codes in the "SPS Warranty Claim Code" field of the transaction, otherwise the transaction will reject. It is best practice to enter the FINAL code provided by SPS/SPS2.

## Warranty Claim Code Information Retrieval

If the Warranty Claim Code was not recorded on the Job Card, the code can be retrieved in the SPS2 system as follows:

1. Open TLC on the computer used to program the vehicle.
2. Select and start SPS2.
3. Select Settings.
4. Select the Warranty Claim Code tab.

The VIN, Warranty Claim Code and Date/Time will be listed on a roster of recent programming events. If the code is retrievable, dealers should resubmit the transaction making sure to include the code in the SPS Warranty Claim Code field.

Version	2
Modified	Released March 01, 2022 Revised May 03, 2022 – Revised 2022 Silverado and Sierra Models

