



SERVICE BULLETIN

Classification: HA22-003	Reference: NTB22-023	Date: March 22, 2022
-----------------------------	-------------------------	-------------------------

BLOWER MOTOR MAKES CLICKING NOISE DUE TO SNOW INTRUSION

APPLIED VEHICLES: 2021 Rogue (T33)

APPLIED ENGINES: PR25DD

IF YOU CONFIRM

A clicking noise is heard coming from the HVAC case while the blower is operating,

AND

Snow and/or ice is found in the HVAC blower motor case.

ACTION

Replace the cowl top cover with one from the **PARTS INFORMATION**.

- Refer to the ESM: **BODY EXTERIOR, DOORS, ROOF & VEHICLE SECURITY > EXTERIOR > REMOVAL AND INSTALLATION > COWL TOP > Removal and Installation**

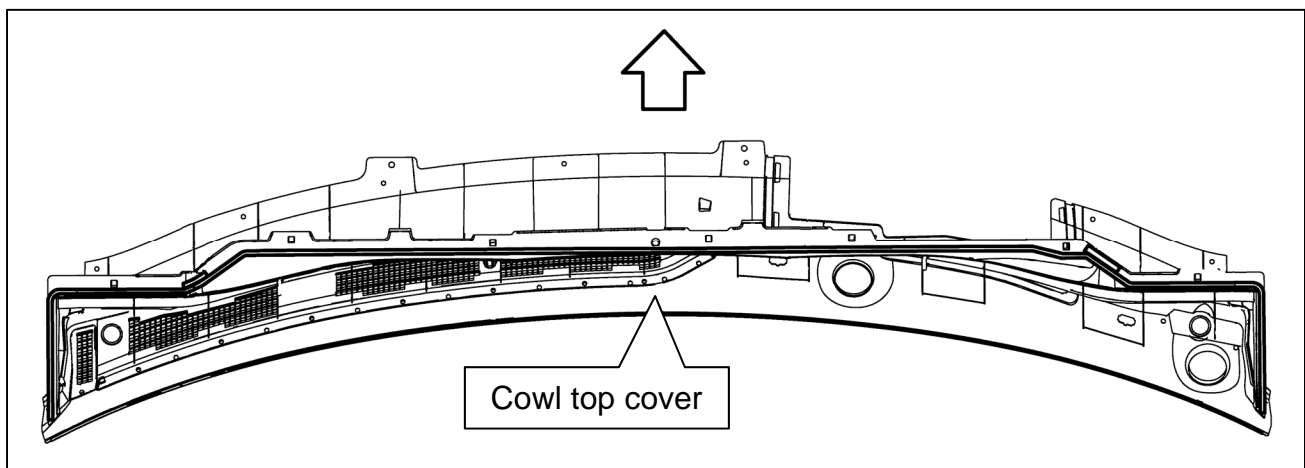


Figure 1

IMPORTANT: The purpose of **ACTION** (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire ESM service procedure as it contains information that is essential to successfully completing this repair.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, **DO NOT** assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

PARTS INFORMATION

GRADE	DESCRIPTION	PART NUMBER	QUANTITY
S, SV	Cowl Top Cover	66862-6RR0B	1
SL	Cowl Top Cover	66862-6RR2B	1

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Install Cowl Top Cover	(1)	UE24AA	ZL	32	(2)

- (1) Reference the **PARTS INFORMATION** table above and use the Cowl Top Cover as the Primary Failed Part (PFP).
- (2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated Flat Rate Time (FRT).

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
March 22, 2022	NTB22-023	Original bulletin published

