

A PDF of this newsletter and previous ones can be found by logging in to ServiceNet and clicking on the [Elsa Newsletter](#) section in the Technician References menu.

VW Elsa Newsletter



Das Auto.

Edition 62: November 18, 2013

Content

- [Technical Bulletins](#)
- [Pending Service Solutions](#)
- [Tech Tips](#)
- [Campaigns](#)
- [Updates](#)
- [Suggestions](#)



Technical Bulletins

**01 13 36 - 2012810 Supersedes T. B. V011130 dated December 22, 2011 to include latest available valve body part number information.
Update Programming, ECM, TCM Software Update and Valve Body Replacement for Harsh Up - Down Shift from Transmission when Cold**

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Passat, Passat Wagon, Jetta, Jetta Wagon	2007–2008	2.0L (BPY)	6 Spd Auto	All	All

Customer may experience harsh up shift in gears 1-2 and 2-3, or harsh down shift in gears 3-2 and 2-1. The symptom is most noticeable at transmission temperatures below 60°C (140°F).

No DTCs are stored in the TCM or the ECM for this complaint.

Comfort concern only.

Production Solution: Updated transmission valve body, ECM and TCM software.

17 13 04 - 2035713 Pentastar Engine Oil Filter Application Reference

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Routan	2014	3.6L (CJRA)	All	All	All

A change was made to the engine Oil Filter Adapter (OFA) for 2014 Model Year vehicles that also drove a change in the oil filter element.

Production Solution: Pentastar Oil Filer Adaptor Change for MY 2014 Routan.

57 13 01 - 2035718 Procedure for Communication Interruptions Following Door Control Module - Window Motor Replacement

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Jetta (A5)	2005–2008	All	All	All	All
Jetta Wagon (A5)	2008	All	All	All	All

The latest generation door control module, which are Unified Diagnostic Service (UDS) diagnosis compatible, are available for repair or part exchange on the models named above. Please note, in individual cases, there may be communication problems with the newly installed door control module during diagnosis and connection (coding, adaption, parametering etc.).

Production Solution: Not applicable.

Pending Service Solutions

No new pending service solutions this week.

[Back to top](#)

Tech Tips

44-13-03TT - Jetta/Sportwagen, Golf/GTI, Passat/CC, Tiguan, Touareg, Routan Four Wheel Alignments Four Wheel Alignments

Model(s)	Year	Eng. Code	Trans. Code
Jetta, Sportwagen, Golf, GTI, Passat, CC, Tiguan, Touareg, Routan	2012–2014	All	All

This Tech Tip provides an overview of vehicle four wheel alignment, and important steps that should be followed when performing four wheel alignments.

Note:

Email a scanned copy of the before and after alignment measurements to VWGoA.Chassis@vw.com, and file the printed copy with the Repair Order. If a Volkswagen Technical Assistance (VTA) ticket was opened, the alignment before and after measurements should be attached, before the VTA is closed. This is required for all alignment check or repairs performed under warranty. Email must include the following information:

- VIN
- Repair Order (RO) Number
 - Mileage (from RO)
 - Dealer Code

The alignment data must be a legible scanned copy of the original print or screen capture (picture). The recommended formats are PDF or JPEG.

[Back to top](#)

Campaigns

No new campaigns this week

[Back to top](#)

Updates

24AE 1.8T ECM/TCM Software (FED_EMS)					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Passat, Jetta	2014	1.8T (CPRA, CPKA)	All	Check Elsa on the day this vehicle UPDATE will be performed to verify vehicle eligibility	Check Elsa on the day this vehicle UPDATE will be performed to verify vehicle eligibility
<p>This update has been proactively released to prevent shift quality concerns and/or rough running behavior depending on driving conditions. This UPDATE is in effect until removed. Vehicle must meet all of the following criteria:</p> <ul style="list-style-type: none">• Procedure is valid only for vehicles that show the 24AE code in Elsa, Campaign/Action Information screen on the day of repair.• If the vehicle is sold it must be within the FEDERAL EMISSIONS WARRANTY.					

Suggestions

Please send comments or suggestions to: vwoa.workshopinformation@vw.com

[Back to top](#)

© 2013 Volkswagen of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.