Ξ

Selective Catalytic Reduction (SCR) Muffler Troubleshooting Guide - US10+OBD13 And Newer Emissions

Component Overview

The SCR contains a coated substrate that, with the input of heat and DEF, changes NOx into nitrogen and water vapor. The SCR's job in the Emissions After-Treatment System (EATS) is to lower the NOx level emitted into the atmosphere.

The performance of the SCR is evaluated by the NOx sensors. There are NOx sensors that are located on upstream (inlet) and downstream (outlet) ends of the SCR.

Important: the SCR is the last component in the EATS which makes it susceptible to any upstream failures.

Primary failure mode of the Muffler (SCR) is:

- · Coating of the substrate being compromised
- Indigestions of foreign objects such as oil, coolant, fuel, etc.

Diagnosis and Repair

Prior to proceeding with any of the information below, any codes, symptoms or failures of upstream components must be diagnosed and corrected first.

Upstream components include:

- Base Engine (Starting or operation issues)
- EGR System
- Fuel System (Engine supply and aftertreatment hydrocarbon injector supply)
- Turbocharger/Boost
- Diesel Oxidation Catalyst (DOC)
- Diesel Particulate Filter (DPF)
- Aftertreatment sensors (Exhaust temperature)

💭 Live UI

me me DTCs below indicate problems with SCR function. These DTCs

Article

should only be diagnosed if they are active or if the DTC Confirmed status is True in the Detailed status information section.

Fault Code	Descriptions
P20EE	SCR NOx Catalyst Efficiency Below Threshold (Bank 1)
P103C	NOx Catalyst Efficiency Inducement, Selective Catalytic Reduction (SCR) Unit
P207F	SCR NOx Catalyst Efficiency Below Threshold (Bank 1)

Evaluations for SCR Muffler Replacement

The following systems need to be evaluated in progressive order to determine the state of the SCR.

- 1. DEF System Test the Urea/DEF Systems functionality for proper:
 - Quality
 - Check DEF Quality using Refractometer (88890105)
 - Litmus Test paper (88890110)
 - Quantity
 - SCR Dosing Test in PTT, Operation 2589-08-03-05 subsection 1-3.
 - With the dosing nozzle removed, inspect for crystal build up.

If any of the above tests fail: Correct the issue, clear fault codes, and release the truck.

2. NOx Sensor Condition - Evaluate the condition of both NOx Sensors.

- Look for the following:
 - Non-OEM (3rd party) sensors, use CBR-2114 for guidance.
 - Any/All NOx sensor fault codes. See CBR-2116 for a list of these faults and recommendations.

If Non-OEM or faulty Nox Sensor(s) is found: Replace the sensor(s), clear faults and release the truck.

Article

Emission	PTT Operation	Action
Level		
OBD 13-16	2549-08-03-03 Nox Conversion Test	Follow test recommendation, if no fault found replace the SCR in accordance with Impact procedures.
OBD 17-18 VGT Only	2589-08-03-18 Exhaust Aftertreatment System Analysts (make sure Nox and SCR Subtest are selected)	Follow test recommendation and release truck.
OBD 17-18 TC Only	No test	Replace Both Nox Sensors if not replaced within past 3 months and release truck. If truck has received both Nox sensors within past 3 months replace the SCR in accordance to impact procedures.
OBD 19 and Newer VGT Only	2549-08-03-03 Nox Conversion Test OR (whichever is available) 2589-08-03-18 Exhaust Aftertreatment System Analysts (only Nox Subtest available)	Follow test recommendation, if no fault found replace the SCR in accordance to Impact procedure.
OBD 19 and Newer TC Only	2549-08-03-03 Nox Conversion Test	Follow test recommendation, if no fault found replace the SCR in accordance to Impact procedures.

Rules for Replacement

Standard Diagnostic time is 3 hours.

Note that Warranty will only cover replacement of the SCR if one of the

Live UI odes in the section above is present. If the SCR is suspected to nave railed due to upstream contamination with no codes present, an

eService case is required for further evaluation.

Review the video link below.

SCR MUFFLER




Related links and attachments

No links or attachments available



Give feedback


to help improve the content of this article

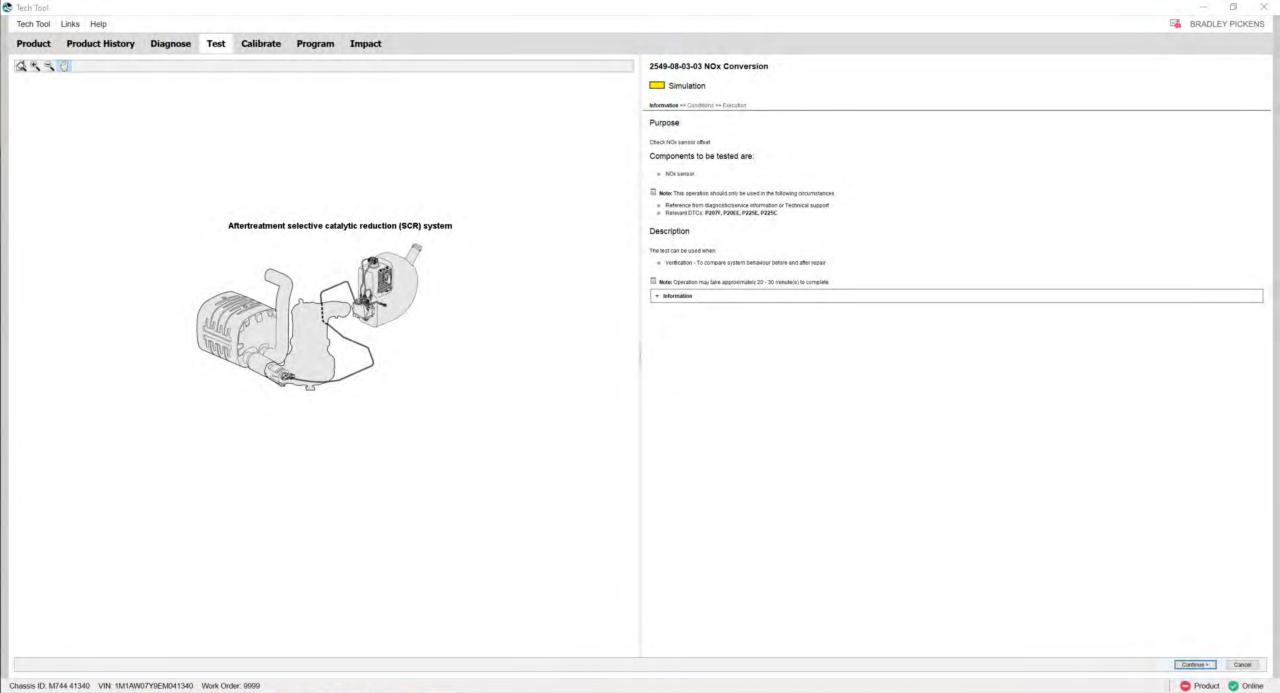


3:31 PM

6/1/2022



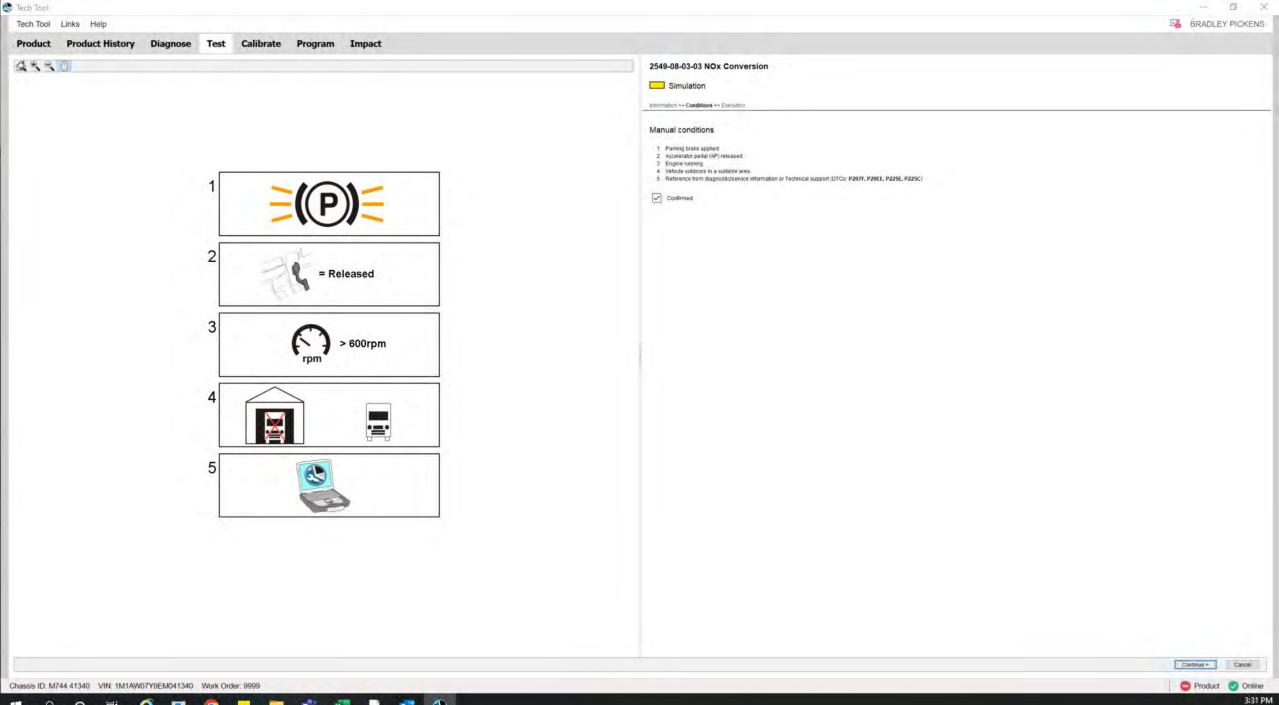


🖿 2 O 🛱 🧲 🖬 😪 🥊 🥫 📲 🗋 🔩 🎨

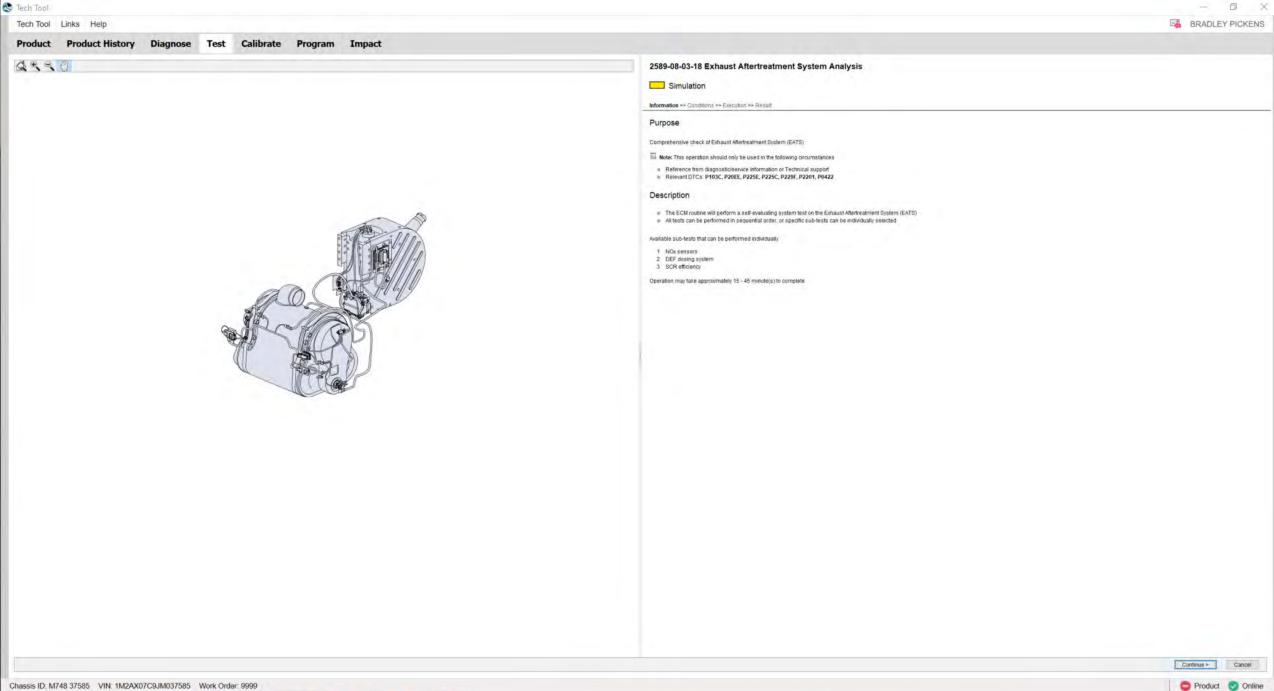

3:38 PM

6/1/2022

٩

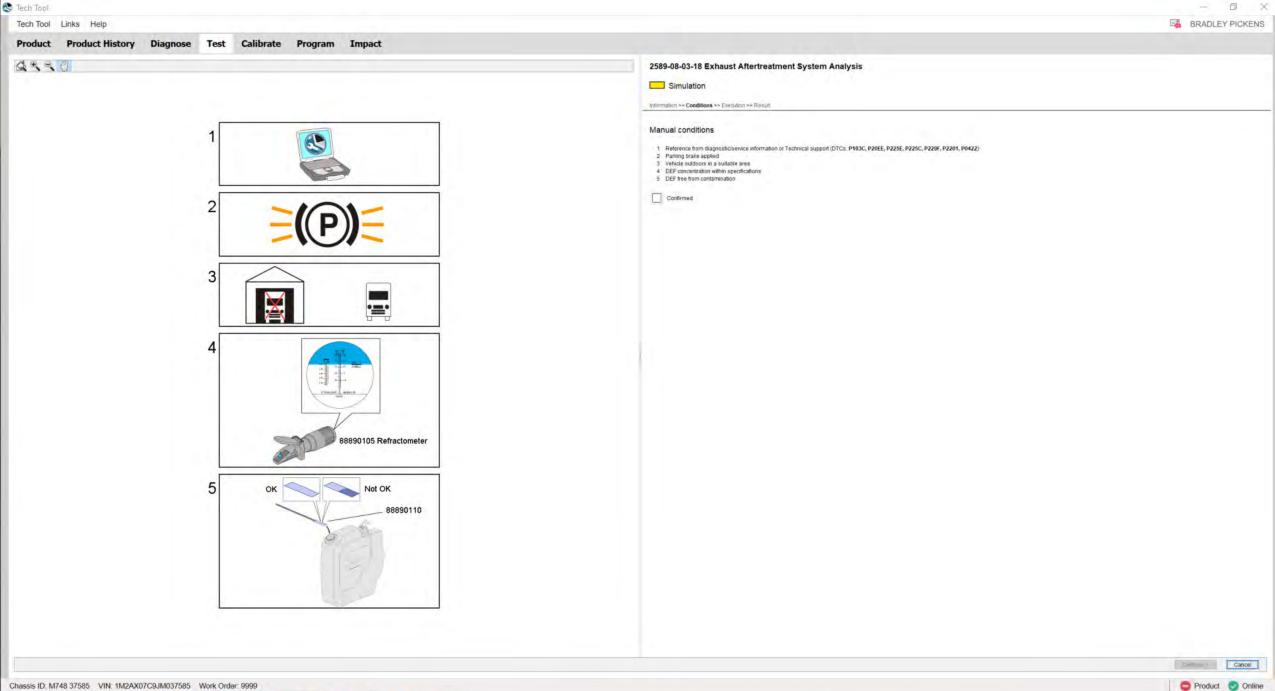

Chassis ID: M748 37585 VIN: 1M2AX07C9JM037585 Work Order: 9999



Tech Tool	- 0 >
Tech Tool Links Help	BRADLEY PICKENS
Product Product History Diagnose Test Calibrate Program Impact	
Start	2589-08-03-18 Exhaust Aftertreatment System Analysis Simulation Intermation >> Conditions >> Execution >> Result * Information * Information * Action
DEF System Status: Waiting for start	Technical Support. Note: All subtests are enabled by default Deselect which subtests are not to run Not sensors DEF desing system. SCR efficiency.
Primary Parameters Secondary Parameters	Image: Static parameters, initial readout Image: Static parameters, initial readout Image: Static parameters, initial readout
	Continue *
Chassis ID: M748 37585 VIN: 1M2AX07C9JM037585 Work Order: 9999	🔁 Product 🥑 Online
	3:39 P

6/1/2022

	9 Tech Tool	and a second	0 >
Sense <	Tech Tool Links Help	🛃 BRADL	EY PICKENS
Kor did regars Kor di	Product Product History Diagnose Test Calibrate Program Impact		
Normating some Norma	Test result	Simulation Information >> Candition >> Execution >> Result Result	
DF data yven DF data SCR HTGLENY DF data	NOx outlet response	NOx intel response NOX outlet response NOX outlet response NOX outlet response NOX outlet response NOX fested DEF dosing system Kittested SCR efficiency	
Reference Max Decrement Compared on some andreded Compared on andreded model Compared on and decoded model Compared on andreded model Compared on andred	SCR efficiency	Detailed information Image: Contract of the second seco	
Reference Come Decrepter Come Compared, sure entry distand Come Compared Come Compared Comp		* SCR efficiency test values	
Image: Complete , energy setended			
	Test Completed, no errors detected Test Completed, error detected Test Completed, error detected Test not completed Test not completed Not tested		
		Continue >-	
Chassis ID: M/48 3/585 VIN: 1MZAXU/C9JM03/585 Work Order: 9999	Chassis ID: M748 37585 VIN: 1M2AX07C9JM037585 Work Order: 9999	e Produi	ct 🕝 Online

 Ē

Non-OEM (3rd Party) NOx Sensor Identification

> Internal Content

If one or more of the codes below are present it is recommended to inspect for 3rd party NOx sensors. P103C-00 P207F-00 P026D-00

3rd party NOx sensors have been found to induce erroneous faults and cause various system failures. If 3rd party NOx sensors are found they should be removed and replaced with a genuine OEM sensor. Clear faults and verify the repair.

Use the below information to identify 3rd party NOx sensors.

How To Verify An OEM Sensor


For Trucks MY 2017 and newer products run **Premium Tech Tool Test 1700-08-03-06 Sensor and Parameter Values.** All genuine OEM NOx sensors will display the expected values as seen below. All other values are components from a 3rd party.

700-08-03-06 Sensor and Parameter Values, M	onitoring
nformation >> Conditions >> Execution	
Selected signals	
P1M4N[1][3] - CVN NOX 1 (EMS)	
P1M4N[1][4] - CVN NOx 2 (EMS)	

Expected Values		
NOx1	NOx2	
791293237	541003308	

Refer to the illustrations below to help identify 3rd party NOx sensor.

OEM sensor with markings and part number for reference

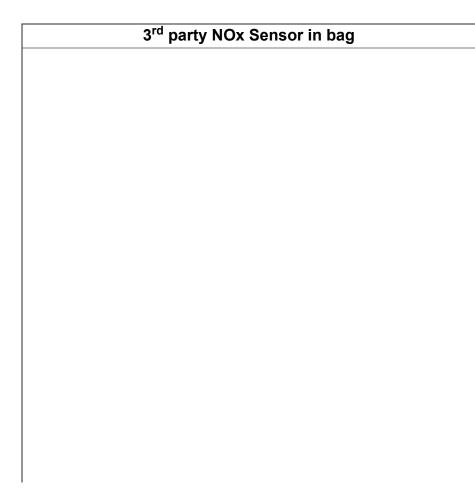

6/1/22, 3:23 PM

Article




3rd party sensors with and with out markings

💭 Live UI

🖵 Live UI



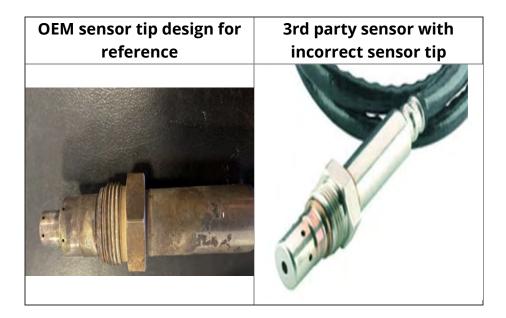

The table below illustrates how difficult it can be to identify 3rd party sensors when compared to an OEM sensor

Article

Resolution of a constant of the second of th	
Sticker says "Warranty void"	No such sticker
Marking text: "PreSCR"	Marking text: "Pre SCR"
Marking text: "CONTINENT AL"	Marking text: "CONTINENTAL"
Marking text font: different from Volvo part	
Conclusion: The sensor on the left is not a Genuine Volvo NOx Sensor	

Τ.

6/1/22, 3:23 PM		Article	
3rd party nox sensor	p103c p2	p207f p026d	
volvo mack	spn 1231 fmi 2		
Related links and at No links or attachmen		Feedback	

Give feedback

to help improve the content of this article



NOx Sensor Troubleshooting Guide - US10+OBD13 And Newer Emissions

ЬŢ

Component Overview

There are two Nitrogen Oxide (NOx) sensors in the Exhaust Aftertreatment System, an INLET and OUTLET. They are smart sensors reporting on the DL7 (J1939-7) data link and they measure the INLET (Pre SCR) and OUTLET (Post SCR) of NOx. The NOx sensors have unique CAN identification numbers and cannot be swapped. Additionally these sensors are not operational until the exhaust is up to operating temperature and free of moisture. The Engine Control Module compares the INLET and OUTLET NOx readings to evaluate the efficiency of the SCR.

The primary failure mode the NOx Sensors is internal failure, which will generate a sensor specific fault code.

Diagnosis and Repair

Review the tables below to determine which category the Fault Code currently being diagnosed falls under. Proceed according to the instructions for the appropriate section.

INLET NOx Sensor (NOx 1) Diagnostic Trouble Codes - Sensor Failure REPLACE the sensor if any codes in red below are active and/or confirmed. Do not replace for inactive codes.

Fault	Foult Departmention	
Code	Fault Description	
P22FB-92	NOx Sensor Performance - Sensing Element Bank 1 Sensor 1,	
PZZEB-9Z	Performance or Incorrect Operation	
P220E-93	NOx Sensor Heater Control Circuit Range/Performance (Bank 1	
FZZUE-93	Sensor 1), No operation	
P2200-13	NOx Sensor Bank 1 Sensor 1, Circuit Open	
P2203-00	NOx Sensor Circuit High Bank 1 Sensor 1	
P2205-13	NOx Sensor Gas Outlet Open Circuit, Circuit open	
P2206-00	NOx sensor heater control circuit low, bank 1 sensor 1	
P2208-00	NOx sensor heater sense circuit, bank 1 sensor 1	

💭 Live UI

urecuon/Repair: Replace the sensor in accordance with Impact

Ξ

Do NOT Cut the sensor wiring harness, all NOX sensors are currently on mandatory return.

Inlet NOx Sensor (NOx 1) Diagnostic Trouble Codes - Potential Sensor Failure

These codes in yellow below indicate that the inlet NOx sensor is potentially damaged, but further investigation is required to verify sensor condition.

Fault Code	Fault Description
P026C-00	Fuel Injection Quantity Lower Than Expected
P026D-00	Fuel Injection Quantity Higher Than Expected
P2201-64	NOx Sensor Bank 1 Sensor 1, Signal plausibility failure
P225C-00	NOx Sensor Performance - Signal Stuck High Bank 1 Sensor 1

Direction: Run the applicable PTT Operation per OBD Level.

Emission Level	PTT Operation
OBD 13- 16	2549-08-03-03 Nox Conversion Test
OBD 17- 18 VGT Only	2589-08-03-18 Exhaust Aftertreatment System Analysts (make sure Nox Subtest is selected)
OBD 17- 18 TC Only	No test… Replace INLET (Nox 1) Nox Sensors if not replaced within past 3 months and release truck. If Nox sensor has beer replaced within past 3 months open an E-Service Case.
	2549-08-03-03 Nox Conversion Test
OBD 19 and Newer VGT Only	OR (whichever is available)
	2589-08-03-18 Exhaust Aftertreatment System Analysts (only Nox Subtest available)
OBD 19 and Newer TC	2549-08-03-03 Nox Conversion Test

Repair:

• If the INLET (NOx1) sensor fails the evaluation, replace the Inlet NOx Sensor ONLY.

• If the NOx2 sensor (Outlet NOx Sensor) fails the test, disregard the results.

OUTLET NOx Sensor (NOx 2) Diagnostic Trouble Codes -Sensor Failure

REPLACE the sensor if any codes in red table below are active and/or confirmed. Do not replace for inactive codes.

Fault Code	Fault Description
P220F-93	NOx Sensor Incorrect Value at Startup, No operation
P229E-13	NOx Sensor Bank 1 Sensor 2, Circuit open
P22A6-00	NOx sensor heater sense circuit, bank 1 sensor 2
P22A1-00	NOx Sensor Circuit High Bank 1 Sensor 2
P22A3-13	NOx Sensor Heater Control Bank 1 Sensor 2, Circuit open
P22A4-00	NOx sensor heater control circuit low, bank 1 sensor 2
P22FE-00	NOx Sensor Performance - Sensing Element Bank 1 Sensor 2

Direction/Repair: Replace the sensor in accordance with Impact instructions.

Do NOT Cut the sensor wiring harness, all NOX sensors are currently on mandatory return.

Outlet NOx Sensor (NOx 2) Diagnostic Trouble Codes -Potential Sensor Failure

Fault Code	Fault Description	
P225E-00	NOx Sensor Performance - Signal Stuck High Bank 1 Sensor 2	

Direction: Run the applicable PTT Operation per OBD Level.

	Emission Level	PTT Operation
	OBD 13- 16	2549-08-03-03 NOx Conversion Test
	OBD 17- 18 VGT Only	2589-08-03-18 Exhaust Aftertreatment System Analysts (make sure NOx and SCR Subtest are selected)
	Live UI C	No test Replace Outlet (NOx 2) NOx Sensors if not replaced within past 3 months and release truck. If NOx sensor has been
ļ	Only	renlaced within next 3 months open an F-Service Case

https://volvo-trkna-prod1.pegacloud.net/prweb/PRAuth/app/VolvoKM /iNPUIKpeinqPJi2G0hH930k43USdE1gb*/!TABTHREAD9?pyActivity=%40basec... 3/6

22, 3:25 PM		Article	
L	Ошу	теріасеч іншін разі о піонінэ орен ан с-остлісе базе.	
	OBD 19		
	and	2549-08-03-03 NOx Conversion Test	
1	Newer VGT Only	OR (whichever is available)	
		2589-08-03-18 Exhaust Aftertreatment System Analysts (only Nox Subtest available)	
_	OBD 19 and Newer TC Only	2549-08-03-03 NOx Conversion Test	

Repair:

• If the Outlet (NOx 2) sensor fails the evaluation, replace the Outlet NOx Sensor ONLY.

• If the NOx 1 sensor (Inlet NOx Sensor) fails the test, disregard the results.

Diagnostic Trouble Codes With NOx Sensor in the Description

Direction/Repair: **DO NOT REPLACE** the NOx sensor(s) for these codes. Diagnostics should be performed using PTT Diagnostics and the comment section in the table below.

Fault Code	Fault Description	Comments
P220A-1C	NOx Sensor Supply Voltage Circuit (Bank 1	Power
1 2204-10	Sensor 1), Circuit voltage out of range	supply
P220B-1C	NOx Sensor Gas Outlet High Voltage, Circuit	Power
F220D-1C	voltage out of range	supply
	NOx Sensor Performance - Signal Stuck Low Bank 1 Sensor 1	Sensor
P225D-00		reading fresh
		air
	NOx Sensor Performance - Signal Stuck Low Bank 1 Sensor 2	Sensor
P225F-00		reading fresh
		air
		Most likely
U029D-00	Lost Communication With NOx Sensor "A"	Harness
		Issue
		Most likely
Live UI00	Lost Communication with NOx Sensor B	Harness
		Issue

Article

P229F-64	NOx Sensor Gas Outlet Removed, Signal	Nuisance
	plausibility failure	code, most
		likely "Confirmed =
		False"

Although the codes above have the term "NOx sensor" in their descriptions, it is highly unlikely that the sensor is the cause of any of these codes. The table above specifies the likely cause of each code.

Rules for Replacement

Warranty will only cover replacement of the NOx Sensors if one of the codes in Red or Yellow listed above is active or confirmed. If the NOx Sensor is suspected to have failed with no active or confirmed codes, an eService case is required for further evaluation.

Review the video link below.

NOx Sensor

Standard Diagnostic Time for a NOx Sensor is 1.0 hr.

Tags			
p2200-13	p2203-00	p2205-13	p2206-00
p2208-00	p026c-00	p026d-00	p2201-64
p225c-00	p220f-93	p229e-13	p220a-1c
p220b-1c	p225d-00	p225f-00	u029d-00
u029e-00	p229f-64	p22fb-92	p220e-93
p22a6-00 Live UI	p22a1-00	p22a3-13	p22a4-00
p22te-00	p225e-00	p20ee-00	p103c-00

unlocking uptime

p207f-00

volvo mack

Related links and attachments

No links or attachments available

Feedback

Give feedback

to help improve the content of this article

