



© 2015 Mazda Motor of America, Inc.

Subject: ENGINE OIL SEEPAGE FROM ENGINE OIL PRESSURE SWITCH	Bulletin No: 01-014/15
	Last Issued: 12/17/2015

BULLETIN NOTE

- This bulletin supersedes the previous bulletin 01-014/15, issued on 07/14/2015. The APPLICABLE MODEL(S)/VINS, DESCRIPTION, PART(S) and WARRANTY INFORMATION have been revised.
- Changes are noted below in Red beside the change bar.

APPLICABLE MODEL(S)/VINS

- 2016 CX-3 vehicles with VINs lower than JM1 DK ***** 103786 (produced before June 01, 2015)
- 2013-16 CX-5 vehicles with VINs lower than JM3 KE ***** 672620 (produced before June 01, 2015)
- 2011-15 Mazda2
- 2016 Mazda2 (Mexico only) vehicles with VINs lower than 3MD DJ6 ***** 102670 (produced before August 03, 2015)
- 2012-13 Mazda3
- 2014-15 Mazda3 (Japan built) vehicles with VINs lower than JM1 BM ***** 276064 (produced before June 01, 2015)
- 2014-16 Mazda3 (Mexico built) vehicles with VINs lower than 3MZ BM ***** 246446 (produced before August 03, 2015)
- 2014-16 Mazda6 vehicles with VINs lower than JM1 GJ ***** 434937 (produced before June 01, 2015)

DESCRIPTION

Frequent engine starts under extremely cold ambient temperatures may result in oil seepage from the engine oil pressure switch. This concern may be caused by a lack of durability of the oil pressure switch under these conditions. To correct the problem, the oil pressure switch has been improved to increase the durability in cold ambient temperatures.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify customer concern.
2. Replace the engine oil pressure switch. Refer to MS3 online or the Workshop Manual (section 01-11 OIL PRESSURE SWITCH REMOVAL/INSTALLATION).
3. Verify repair.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical—including photocopying and recording and the use of any kind of information storage and retrieval system—without permission in writing.

Bulletin No: 01-014/15
© 2015 Mazda Motor of America, Inc.

Last Issued: 12/17/2015

PART(S) INFORMATION

Part Number	Description	Qty.	Note
PE01-18-501B	Oil Pressure Switch	1	Except 2011-2015 Mazda2
B367-18-501A	Oil Pressure Switch	1	2011-2015 Mazda2

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty and California Emission Warranty (short term) or PZEV where applicable.
- Additional diagnostic time cannot be claimed for this repair.

	Except 2011-2015 Mazda2	2011-2015 Mazda2
Warranty Type	A	A
Symptom Code	76	76
Damage Code	9E	9E
Part Number Main Cause	PE01-18-501A	B367-18-501A
Quantity	1	1
Operation Number / Labor Hours:	XXL4DXRX / 0.4 Hrs.	XXL4DXRX / 0.3 Hrs.