



Service Bulletin

Bulletin No.: 22-NA-027

Date: June, 2022

TECHNICAL

Subject: LM2 Diesel With Possible Oil Consumption - DTC P06DD Set

The bulletin replaces PIP5762. Please discard PIP5762.

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade Models	2021	2022			LM2	
Chevrolet	Silverado 1500	2020	2021				
	Silverado 1500 - LTD (RPO J21, VIN Digit 5 = W/Y)	2022	2022				
	Silverado 1500 - New (RPO J22, VIN Digit 5 = A/D)						
	Suburban	2021	2022				
	Tahoe						
GMC	Sierra 1500	2020	2021				
	Sierra 1500 - Limited (RPO J21, VIN Digit 5 = 8/9)	2022	2022				
	Sierra 1500 - New (RPO J22, VIN Digit 5 = H/U)						
	Yukon Models	2021	2022				

Involved Region or Country	North America, Russia, Middle East, Chile (West), Colombia (West), Ecuador (West), Paraguay (West), Peru (West), Japan, Cadillac Korea (South Korea), Thailand (ASEAN), Australia/New Zealand
Condition	Some customers may comment on oil consumption. Some technicians may find DTC P06DD set.
Cause	Camshaft housing (cover) may have a baffle plate weld that is not adequate.

<p>Correction</p>	<div data-bbox="683 155 1333 730" data-label="Image"> </div> <div data-bbox="1414 737 1484 758" data-label="Text">5671019</div> <div data-bbox="683 772 1333 1348" data-label="Image"> </div> <div data-bbox="1414 1354 1484 1375" data-label="Text">5671020</div> <ul style="list-style-type: none"> • If the serial number is greater than 21298JDXXX, this bulletin does not apply. Refer to bulletin 21-NA-272 and SI for appropriate diagnostics. • If the serial number is less than 21298JDXXX and the customer's concern is oil consumption: <ol style="list-style-type: none"> 1. 1) Replace the camshaft housing cover. 2. 2) Replace the #2 glow plug. <p>Re-evaluate the oil consumption.</p>
-------------------	--

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Service Procedure

Refer to *Camshaft Housing Replacement* in the Service Manual and *Glow Plug Replacement - Cylinder 2* in the Service Manual.

Parts Information

Use the vehicle identification number (VIN), SI, and the GM Electronic Parts Catalog to determine the correct part to order.

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Model	Labor Time
4087688*	Replace Camshaft Housing and Glow Plug	Silverado 1500 Sierra 1500	14.0 hr
		Escalade Models Suburban Tahoe Yukon Models	12.3 hr
*This is a unique Labor Operation for Bulletin use only.			

Version	3
Modified	Released February 02, 2022 Revised April 19, 2022 - Update Cell-Link in Service Procedure and Update Labor Time in Warranty Information section. Revised June 14, 2022 - Update Labor Time in Warranty Information section.

