

Service Bulletin

TECHNICAL

Subject: Malfunction Indicator Lamp (MIL) Illuminated - DTC's P0202 and/or P0216 Set

Reference PIP5840 When Performing Repair

| Brand: | Model: | Model Year: | | VIN: | | Engino | Transmission: |
|-----------|-----------------|-------------|------|------|----|---------|---------------|
| | | from | to | from | to | Engine: | fransmission. |
| Cadillac | Escalade Models | 2021 | 2022 | | | LM2 | |
| Chevrolet | Silverado 1500 | | | | | | |
| | Suburban | | | | | | |
| | Tahoe | | | | | | |
| GMC | Sierra 1500 | | | | | | |
| | Yukon Models | | | | | | |

| Involved Region or Country | North America |
|---|---|
| Condition | Some customers may comment that the MIL is illuminated. Some customers may also comment that the engine runs rough. Some technicians may find one or more of the following DTCs set: Note: DTC P0216 may or may not be set. • P0202 • P0216 |
| Cause | This condition may be caused by a broken terminal pin inside the #2 injector harness connector. |
| Correction If the #2 injector has been identified as the concern, replace the #2 fuel injector wiring harness. | |

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Service Procedure

Refer to PIP5840: Modify Sound Insulator During Service, *Fuel Injector Wiring Harness Replacement* in the Service Manual and *High Pressure Diesel Fuel Injector Replacement* in the Service Manual.

Parts Information

| Causal Part | Description | Part Number | Qty |
|----------------|-------------------------------------|----------------|-----|
| N/A | HARNESS, F/ INJR WRG | 55513485 | 1 |
| x | INJECTOR, HIGH PRESS DSL FUEL | 55506244 | 1 |

Warranty Information

For vehicles repaired under the Emission coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

| Labor Operation | Description | Labor Time |
|--|---|------------|
| 4088718* | High Pressure Diesel Fuel Injector and Harness Repair | 4.8 hr |
| *This is a unique Labor Operation for Bulletin use only. | | |

| Version | 2 |
|----------|--|
| Modified | Released May 05, 2022 Revised June 15, 2022 - Remove DTCs not Applicable to Bulletin and Updated Warranty Information Section. |



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION