

SSM 50904 - 2022 Expedition/Navigator - Fuel Gauge Reads Empty With DTC P0460:13 - Built On Or Before 25-Mar-2022

Some 2022 Expedition/Navigator vehicles built on or before 25-Mar-2022 may experience a fuel gauge that reads empty with DTC P0460:13. DTCs P0461/P0463 may also be present. This may be due to an open circuit in the fuel level sender (FLS). To correct the condition, replace the FLS using service part number NL1Z-9A299-A. Refer to Workshop Manual (WSM), Section 310-01. For claiming, use causal part 9A299 and applicable labor operations in Section 09 of the Service Labor Time Standards (SLTS) Manual.

APPLICABLE VEHICLES

2022 TRUCK: B8 U553N EXPEDITION

2022 TRUCK: B9 U554N NAVIGATOR