



## STAR ONLINE PUBLICATION



**Case Number: S2109000001**

**Release Date:** 01/21/2021

**Symptom/Vehicle Issue:** Customer may complain of a MIL lamp on. Upon further investigation there could be a fault code in the PCM for P1524 – Oil Pressure Out of Range – Camshaft Advance/Retard Disabled.

**Customer Complaint/Technician Observation:** If the customer is experiencing the above conditions, check to see if the customer recently had the oil filter changed and had an AMSOIL brand oil filter installed.

**Discussion:** If the vehicle has an AMSOIL brand oil filter installed, remove it and install an applicable MOPAR brand oil filter. Make sure the oil level is correct, add oil if necessary. Erase the fault code in the PCM. Drive the vehicle and see if the fault code returns. If the fault code returns, perform the published fault code diagnostic routine to root cause the condition.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**