


RSB-56-22-001-1: Replace Interior Door Handles

Rivian is launching a technical service bulletin for some model year 2022 R1T vehicles that might have early revisions of interior door handles. In some situations, the handle might snap back when it is released, exerting excess force on the handle and potentially breaking it. If a vehicle is serviced for a broken handle, Rivian will proactively replace all 4 interior door handles with upgraded components.

Document Type	Technical Service Bulletin
Date	July 27, 2022
Affected Region(s)	USA
Affected Model(s)	R1T
Model Year(s)	2022
Approximate Build Dates	August 2021 - March 2022
 Refer to the FSA Dashboard to determine if this document applies to a specific vehicle.	
Vehicle System	56 - Closures
Minimum Service Location	Mobile

Required Parts

Part Number	Quantity	Engineering Name	Service Name/Notes
PT00624870-B	2	RELEASE HANDLE ASSY LH	Handle, Interior, Door, LH
PT00624871-B	2	RELEASE HANDLE ASSY RH	Handle, Interior, Door, RH

! **Attention:** The parts listed in this table are only for unique steps that are called out in this bulletin. Some sections of this bulletin might refer to Service Manual procedures which require additional parts. Always review the bulletin and all potentially related Service Manual procedures before ordering parts and beginning work.

Procedure

1. Replace: Handle, Interior, Front Door, LH (refer to service manual procedure 565020010).
2. Replace: Handle, Interior, Front Door, RH (refer to service manual procedure 565020110).
3. On both sides: Replace: Handle, Interior, Rear Door (refer to service manual procedure 565022010).
4. Reinstall all components that were removed for access and replace all non-reusable components.

Labor Codes

Labor Code	Description
RSB562200100	RSB-56-22-001 not applicable
RSB562200101	Replace 4 interior door handles upon failure of 1 handle
Contact ServiceDocumentFeedback@rivian.com regarding labor codes and document content.	