

**NUMBER:** 23-036-15

**GROUP:** Body

**DATE:** October 07, 2015

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

### SUBJECT:

Door Panel Armrest Pull Cup Loose And/Or Audio Induced Buzz/Rattle

#### **OVERVIEW:**

This bulletin involves inspecting/replacing the armrest door pull cup fastener.

## **MODELS:**

2015 - 2016 (LA)

Dodge Challenger

NOTE: This bulletin applies to vehicles within the following markets/countries: NAFTA

NOTE: This bulletin applies to vehicles built on or after July 20, 2014 (MDH 0720XX) and on or before July 31, 2015 (MDH 0731XX).

#### SYMPTOM/CONDITION:

The customer may describe an audio induced buzz/rattle from the door panel or a loose door armrest pull cup.

This condition may be caused by the door panel armrest pull cup attachment screw not tightened securely.

#### **DIAGNOSIS:**

If the customer describes the symptom/condition listed above, perform the Repair Procedure.

## PARTS REQUIRED:

Qty.	Part No.	Description
AR	06508990AA	Screw, M4.2x1.7x23 with captured washer

23-036-15 -2-

## REPAIR PROCEDURE:

# NOTE: The following service procedure is applicable to the right and left doors.

- 1. Remove the pull cup mat (1) from the door panel armrest handle (Fig. 1).
- 2. Verify that the pull cup screw (2) on both doors is tight or can be tightened securely (Fig. 1).
- 3. Is the screw on both doors tightened securely?
  - a. Yes>>> This Bulletin has been completed.
  - b. No>>> One or both screws cannot be tightened securely. Continue with the Repair Procedure Step #4.
- 4. Remove the screw(s) that will not tighten and obtain a NEW screw from the Parts Required section of this bulletin.
- 5. Install a NEW screw (2) in the door armrest handle pull cup and tighten the screw securely (Fig. 1).
- 6. Install the pull cup mat (1) in the door panel armrest handle (Fig. 1).



Fig. 1 Door Armrest Attachment Screw

- 1 Pull Cup Mat
- 2 Pull Cup Screw

-3- 23-036-15

# POLICY:

Reimbursable within the provisions of the warranty.

# TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
23-20-23-95	Screw, Front Door Pull Cup - Inspect, Tighten or Replace (Left and Right) (1 - Semi-Skilled)	6 - Electrical and Body Systems	0.2 Hrs.

## FAILURE CODE:

ZZ	Service Action
----	----------------