



Technical Service Bulletin

Technical Service Bulletin: TSB210152	Released Date: 01-Jul-2022
Fault Code 8154 or 8155 Caused by Acumen® Connectivity Module Software Update	

Fault Code 8154 or 8155 Caused by Acumen® Connectivity Module Software Update

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- B6.7 CM2450 B155B
- L9 CM2450 L126B
- X12 CM2450 X137B
- X15 CM2450 X124B
- X15 CM2450 X134B

Issue

Acumen® connectivity modules analyzed by the factory have a high rate of trouble **not** found.

Symptom:

- Occurrence of Fault Code 8154 or 8155
- No Lamp/ Silent Fault set by FC8154 or FC8155
- During a firmware update of the Acumen® connectivity module FC8154 or FC8155 will become active. Following published troubleshooting of FC8155 leads to false replacement of the Acumen® connectivity module.

Root Cause:

- Fault Code 8154 or 8155 will become active when part one of the Acumen® connectivity module firmware update completes and will stay present until the Acumen® connectivity module firmware update is completed.

Verification

Verify FC8154 or FC8155 is present.

Resolution

- Follow published troubleshooting procedures for FC8154 or FC8155.
- If troubleshooting tree is exhausted, do **not** replace Acumen® connectivity module. Release unit back to customer.
- If no root cause is identified, FC8154 or FC8155 will clear after Acumen® connectivity module has completed firmware update. This can take a few months based on the module's cellular signal and the key cycle timing.
- Using the Cummins Guidanz® electronic service tool, if the Acumen® connectivity module has the new Acumen® software version, the Acumen® connectivity module **must** be replaced.

Table 1, Acumen® Software Version Matrix

Existing Acumen® Software Version	New Acumen® Software Version
01.000.02&06.091.10&06.091.04	01.000.02&06.100.18&06.100.02
-	01.000.02&06.105.06&06.105.00

Document History

Date	Details
2021-7-15	Module Created
2021-8-13	Added reference to Fault Code 8154.
2022-6-29	Added Table 1. Updated Resolution section.

Last Modified: 01-Jul-2022

<https://cst.cummins.com>
<http://edsprod.cummins.com>
<https://gpst.cummins.com>
<https://quickserve.cummins.com>
<https://parts.cummins.com>
<https://store.cummins.com>
<https://wwsps.cummins.com>
<https://access.cummins.com>
<https://commerce.cummins.com>
<https://qsservices.cummins.com>
<https://webparts.cummins.com>
<https://qsservices.cummins.com>
<https://adminportal.cummins.com>
<0sp4N000000PGNq>
<https://cumminscommerce.force.com>
<https://mylogin.cummins.com/web/idp/login>