

9003418 08/02/2017 MY15, 16, 17 LA, LD

GPOP - Issue Review System

Part Number: 68184587A\$

Part Description: Rotor - Front 2 Piece

Issue Description: For LA, LD SRT vehicles with the 2-piece Front Rotor (BR7 sales code), do NOT replace the rotor for a clicking noise occurring while turning at low parking lot speeds. Instead, remove front wheels and rotors and clean mating surfaces (wheel mounting face, rotor mounting faces (both sides), and hub mounting face) with a Scotch Brite Pad or equivalent, and reassemble. When installing wheel, MUST use clicker/torque wrench, set to 110 ft-lb (150 Nm).

~ _____ ~
Contact us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. Please include the Part Number(s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.
