

TECHNICAL BULLETIN
JTB00314NAS1
14 NOV 2013



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 417-01

Headlamp Inner Lens Stain

AFFECTED VEHICLE RANGE:

F-TYPE (X152)

Model Year: 2014 Onwards
VIN: K00317 Onwards

MARKETS:

USA

CONDITION SUMMARY:

Situation: A stain may be evident on the headlamp inner lens.

Cause: This may be caused by condensation formed on the inner lens due to the breather vent strategy and the inner coating specification.

Action: Should a customer express this concern, follow the Service Instruction outlined below.

PARTS:

T2R12517	Headlamp - RH - AFS - NAS	Quantity: 1
T2R12529	Headlamp - LH - AFS - NAS	Quantity: 1
T2R12767	Headlamp - RH - NAS	Quantity: 1
T2R12768	Headlamp - LH - NAS	Quantity: 1

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:

 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**

 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Headlamp assembly - Vehicle set - Renew - NAS - AFS	86.41.09	0.6 Hours	49	T2R2949
Headlamp assembly - Vehicle set - Renew - NAS - Non-AFS	86.41.09	0.6 Hours	49	T2R12767


 **NOTE: Normal Warranty policies and procedures apply.**

SERVICE INSTRUCTION:

1.  **NOTE: The 'X' shows 'drips' and/or 'staining'. This condition in either the oval or rectangle areas of the lamp is unacceptable and the headlamps must be changed.**

 **NOTE: The 'tick' shows 'spotting'. This condition in the oval area of the lamp is acceptable and the headlamps must not be changed.**

Install a new right and left headlamp assembly (see TOPIx Workshop Manual, Section 417-01).

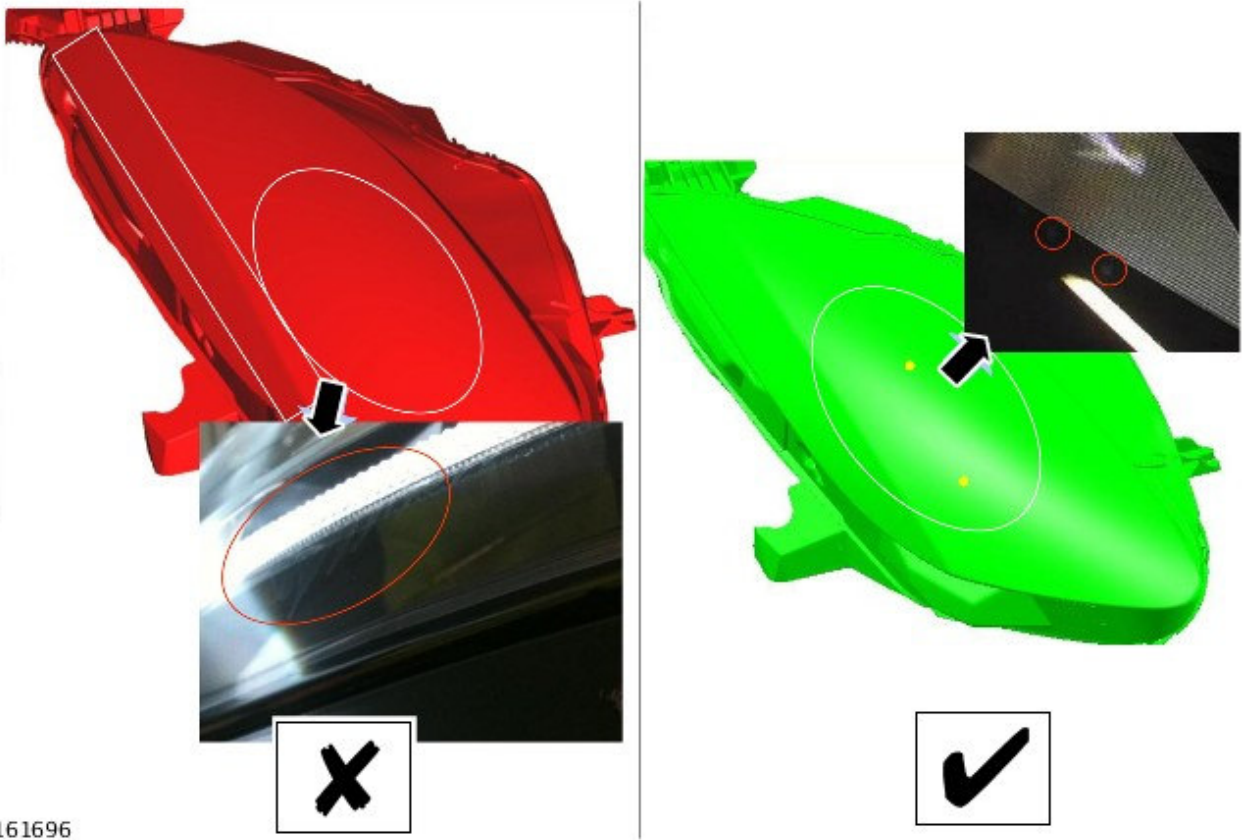

E161696