

Reference	SSM67937
Models	F-TYPE / X152
Title	Blind Spot Monitor Not Available Warning Message
Category	Electrical
Last modified	11-Sep-2013 00:00:00
Symptom	206000 Warning Indicators
Content	<p>*****K00001 - K03122 ONLY*****</p> <p><u>Concern</u> A customer may report, "Blind Spot Monitor not available," displayed in the message center accompanied by the Blind Spot Monitor amber LED indicator dots in both mirrors remaining on for the duration of their trip.</p> <p><u>Cause</u> Under certain driving conditions the Blind Spot Monitor may enter a fail safe condition due to a calibration error.</p> <p><u>Correction</u> In the event of this specific concern, program both left and right Blind Spot Monitor modules. A software fix was first introduced at software level DPLA-14D368-AH, first available on DVD134V5.06 loaded with calibration file 138. This software part number is the same for both left and right Blind Spot Monitors.</p>