

Panoramic Roof Opening Glass Tooth removal.pdf

| | |
|---------------|--|
| Reference | SSM68237 |
| Models | XJ / X351 |
| Title | XJ Moving Panel Rear Edge Tooth Feature Removal |
| Category | Body |
| Last modified | 13-Sep-2013 00:00:00 |
| Symptom | 105000 Roof Options |
| | <p><u>Issue:</u> Creak noise heard from the rear edge of the roof moving / opening panel in a closed position when driving over uneven surfaces. Between the VIN range of V24464 to V59436</p> <p><u>Cause:</u> Moving panel rear edge interior tooth feature coming in to contact with the roof frame when closed. Each tooth on the rear edge of the moving panel is approximately 15mm in length</p> |
| Content | <p><u>Action:</u> First confirm that the noise is from this area by partially opening the panel to the tilt position, does the noise disappear. If noise disappears then using the pictures in the attachment for reference and using a suitable tool remove one tooth from the outer rear edge (both Sides) as circled in the pictures.</p> <p>Should any other noise be heard after this operation please refer to the diagnostic section on TOPIx ref 501-17. Roof Opening Panel.</p> |