

SSM 51172

2022 Expedition/Navigator - Reduced Or Intermittent Power Steering Assist Or Steering Assist Fault Service Required Message In IPC, DTC U2016:47 In PSCM

Some 2022 Expedition/Navigator vehicles may exhibit reduced or intermittent power steering assist levels at engine start up and vehicle not moving or Steering Assist Fault Service Required message in instrument panel cluster (IPC) with diagnostic trouble code (DTC) U2016:47 present in the Power Steering Control Module (PSCM). This may be due to PSCM software. To correct the condition, reprogram the PSCM using the latest software level of the Ford Diagnosis and Repair System (FDRS). For claiming, use causal part 3504 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.