

F-Type Water Leak Presentation v2.pdf

Reference	SSM64797
Models	F-TYPE / X152
Title	F-Type Water Ingress Diagnostic (Trunk).
Category	Body
Last modified	06-Jun-2013 00:00:00
Symptom	110000 Sealing
Content	<p><u>Issue:</u> Water ingress to trunk well</p> <p><u>Cause:</u> Requiremnt for diagnostic.</p> <p><u>Action:</u> If water ingress is identified, review attached document for potential water ingress points and rectify as required: 1) Check both harness grommets under deck lid and ensure seated correctly. (Presentation slide 1) 2) Check the seal between the hood seal and panel. (Presentation slide 2) Picture shows seal removed and sealant pushed in correct location. Sealant should be fully pushed in to ensure no leak path. 3) Check to ensure the battery vent tube pipe grommet is seated correctly - Behind bumper(Presentation slide 3). 4) Remove trunk carpet for access. Check grommet is seated correctly after removing boot carpet, inside of boot behind number plate plinth. (Presentation slide 4). 5) Check Tail Lamp grommets. (Presentation slide 5). 6) Check for application of sealant / putty at the Tail lamp baffle seam above the rear vent. (Presentation slide 6&7) 7) Check for the presence of a water drain in location (Presentation slide 8&9) and if missing fit part. Note;-The arrow on the drain grommet should face the front of the vehicle. And it should be fitted from the outside underside of the vehicle.</p> <p>To validate the repair, water test after these actions and if the problem persists please contact technical support if help is required.</p>