

Front Passenger Footwell And/Or Glove Compartment With Increased Temperature


Topic number	LI83.20-P-075513
Version	1
Function group	83.20 - Heating
Date	11/7/22
Validity	Valid for all vehicles of model series 232
Reason for change	

Complaint

Front passenger footwell and/or glove compartment with increased temperature

Cause

Missing or loose threaded connection at collecting pan (A2068310000) - see picture "Threaded connection"

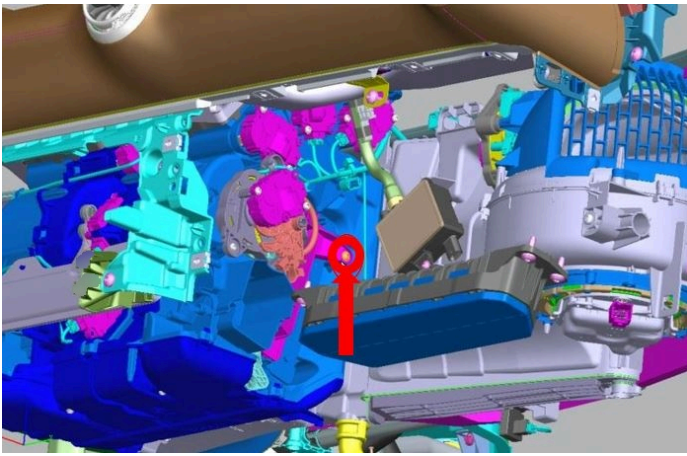Attachments	
File	Description
Schraubverbindung_Auffangwanne.JPG	"Threaded connection"
	

Remedy


Remove glove compartment housing (ar68.10-p-1400sly) and check threaded connection (see picture 1).

If screw N000000008345 is missing or the threaded connection is loose, retrofit/rework accordingly.

Attachments	
File	Description

XENTRY TIPS

000149.jpg

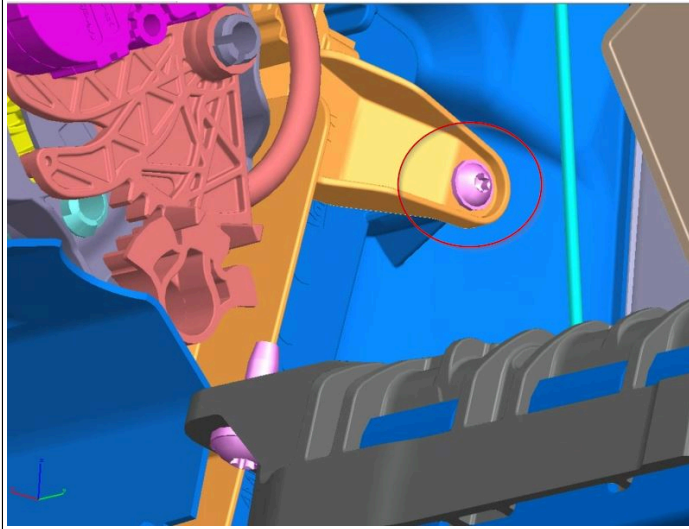

Picture 1

WIS-References

Document number	Title	Note
ar68.10-p-1400sly	Install/remove glove compartment housing	Please take into account

Symptoms

Body > Air conditioning > Air conditioning > Temperature differences

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
---------	----------------	------	-------------	------