

<b>Reference</b>	SSM75153
<b>Models</b>	Discovery Sport / L550 New Range Rover Evoque / L551
<b>Title</b>	L550 / L551 Creak Noise coming from the front of the vehicle while steering.
<b>Category</b>	Chassis
<b>Last modified</b>	29-Nov-2022 00:00:00
<b>Symptom</b>	303000 Steering/Handling
<b>Attachments</b>	111EPASCREAK.png (111EPASCREAK.png) 111EPASCREAK1.png (111EPASCREAK1.png) 111EPASCREAK2.png (111EPASCREAK2.png) 111EPASCREAK3.png (111EPASCREAK3.png) 1lnked1EPASCREAK4_LI.jpg (1lnked1EPASCREAK4_LI.jpg)

<b>Content</b>	<p><b>L550 / L551 20MY Onwards</b></p> <p><b><u>Issue:</u></b> Creak Noise coming from the front of the vehicle while steering.</p> <p><b><u>Cause:</u></b> Clash condition found between steering gear and front subframe.</p> <p><b><u>Action:</u></b></p> <ul style="list-style-type: none"> <li>• Confirm customer complaint</li> <li>• Confirm noise is coming from steering gear area using suitable diagnostic tool</li> <li>• Check vehicle to see if the clash condition occurs between the subframe and steering gear in the areas shown in the attachments. If it does exist – replace front sub frame using part LR157865 Topix 204.01 Uni Body, Subframe and mounting system, front subframe. (CJLR) LR165928.</li> <li>• Once replaced – confirm issue is fixed.</li> </ul> <p>If clash condition doesn't exist – continue with diagnostics as per Topix.</p> <p>Raise ePQR with findings and pictures.</p>
----------------	---

anBhdHRicnM7MjAyMj0xMj0wMj0xMz0xMj0xOC40Mj0xVz0zEzNid4Mj0xNTluMTEzOw==