

Reference	SSM70358
Models	F-TYPE / X152
Title	Centre vent sticking
Category	Body
Last modified	09-Dec-2013 00:00:00
Symptom	107000 Interior Trim
Content	<p><u>Issue:</u> Central vent on dashboard no longer operates (Sticks halfway, does not rise or fall)</p> <p><u>Cause:</u> This is due to the clutch wearing out as a result of the number of steps directed by the software, not ensuring the vent locks out. The new software ensures the vent locks out and will not suffer this failure mode.</p> <p><u>Action:</u> Update the HVAC module with software part EX53-14D520-AD as per JTB000321 Revalidate the vent for several cycles up and down. If still inoperative after updating the software to the latest level then continue all usual investigations and if needed then the IP Vent may need replacing.</p>