



Preliminary Information

PIP5891 SES Lamp Illuminated with DTCs P30D4 P2B95 P02EE P02EF P02F0 P02F1 P02F2 P02F3 P02F4 P02F5 P2B08 P2B09 P2B0A P2B0B P2B0C P2B0D P2B0E or P2B0F Active or Stored in History

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade	2022 - 2023	All	All	6.2L L87	All
Chevrolet	Corvette	2022 - 2023	All	All	6.2L LT2	All
Chevrolet	Silverado	2022 - 2023	All	All	5.3L L84, 6.2L L87	All
Chevrolet	Suburban	2022 - 2023	All	All	5.3L L84, 6.2L L87	All
Chevrolet	Tahoe	2022 - 2023	All	All	5.3L L84, 6.2L L87	All
GMC	Sierra	2022 - 2023	All	All	5.3L L84, 6.2L L87	All
GMC	Yukon	2022 - 2023	All	All	5.3L L84, 6.2L L87	All

Involved Region or Country	North America
Condition	<p>The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this bulletin. Some customers may comment that the SES lamp is illuminated or was illuminated and turned off. During inspection Technician may notice anyone of the following DTCs active or stored in history P30D4, P2B95, P02EE, P02EF, P02F0, P02F1, P02F2, P02F3, P02F4, P02F5, P2B08, P2B09, P2B0A, P2B0B, P2B0C, P2B0D, P2B0E or P2B0F.</p>
Cause	This condition may be caused by a faulty fuel injector causing one of the DTCs to set.

Correction:

To determine if you have a faulty injector follow the diagnostic chart for applicable DTC to ensure there are no other concerns.

If diagnosis leads to no trouble found or a faulty injector, then proceed with injector replacement for the applicable cylinder and reevaluate the vehicle.

Do not replace the ECM for this concern.

Engineering is aware of the concern and is currently investigating the root cause.

This PI will be updated as new information becomes available.

Parts Information

Description	Part Number	QTY.
-------------	-------------	------

Fuel Injector	Per EPC	1
---------------	---------	---

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4021200	Replace Fuel Injector	Use Published Labor Operation Time
4021220	Replace Fuel Injector	Use Published Labor Operation Time

Version History

Version	1
Modified	11/15/2022 - Created on.



© 2022 General Motors. All Rights Reserved.