Reference	SSM75908
Models	Defender / L663
	Discovery / L462
	Discovery Sport / L550
	New Range Rover / L460
	New Range Rover Evoque / L551
	New Range Rover Sport / L461
	Range Rover / L405
	Range Rover Sport / L494
	Range Rover Velar / L560
Title	DTC P013E-00 Stored In Powertrain Control Module P4 And P6 Derivatives Only
Category	Driveability
Last modified	20-Dec-2022 00:00:00
Symptom	698298 Malfunction Indicator Lamp
Content	Issue: When carrying out an engine diagnostic session using TOPIx Cloud Diagnostics, the following
	Diagnostic Trouble Code (DTC) P013E-00 '02 Sensor Delayed Response - Rich to Lean Bank 1 Sensor
	2' may be present in the Powertrain Control Module (PCM).
	Cause: Sensitive trigger point for storage of DTC P013E-00.
	Action: When carrying out diagnosis of DTC P013E-00 and the diagnostic flow guides towards a fault
	with the oxygen sensor do not replace the sensor if the DTC is listed as 'Historic' as it is unlikely the
	sensor is the root cause. If the DTC is listed as 'Confirmed' and after the appropriate diagnostic path and
	continuity checks have been followed with no fault identified, then consideration may be given to a
	replacement oxygen sensor.
	an BhdHRlcnM7MJAyMi0xMi0yMVQxNjc0MjczMC42NTlaOzEzNi4yMjYuNDguMTA2Ow ==