



NUMBER: 09-002-14 REV. B

GROUP: Engine

DATE: December 15, 2014

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

THIS BULLETIN SUPERSEDES SERVICE BULLETIN 09-002-14 REV. A, DATED OCTOBER 3, 2014, WHICH SHOULD BE REMOVED FROM YOUR FILES. ALL REVISIONS ARE HIGHLIGHTED WITH **ASTERISKS.**

SUBJECT:

MIL Illumination: P0300, P0302, P0304 or P0306 (X56 Warranty Extension)

OVERVIEW:

This bulletin involves checking for excessive cylinder leakage and replacing the cylinder head if necessary.

MODELS:

| | | |
|-------------|------|------------------------------|
| 2011 - 2013 | (JC) | Journey |
| 2012 - 2013 | (JK) | Wrangler |
| 2011 - 2013 | (JS) | 200/Avenger |
| 2011 - 2013 | (LC) | Challenger |
| 2011 - 2013 | (LD) | Charger |
| 2011 - 2013 | (LX) | 300 |
| 2011 - 2013 | (RT) | Grand Caravan/Town & Country |
| 2011 - 2013 | (WD) | Durango |
| 2011 - 2013 | (WK) | Grand Cherokee |

NOTE: This Extended Warranty Bulletin applies to vehicles equipped with a 3.6L engine (sales code ERB).

SYMPTOM/CONDITION:

Customers may experience a Malfunction Indicator Lamp (MIL) illumination. Upon further investigation the Technician may find that any the following Diagnostic Trouble Codes have been set:

- P0300- Multiple Cylinder Misfire
- P0302- Cylinder 2 Misfire
- P0304- Cylinder 4 Misfire
- P0306- Cylinder 6 Misfire

DIAGNOSIS:

If the customer experiences the symptom/condition, proceed to the repair procedure.

PARTS REQUIRED:

| Qty. | Part No. | Description |
|--------|------------|--|
| (1) | RL141353AC | Cylinder Head |
| (1) | 05184455AI | Gasket, Cylinder Head |
| (6) | 05184562AC | Seal, Intake Plenum |
| (6) | 05184331AC | Seal, Intake Manifold |
| ** (1) | 5184595AE | Gasket, Cylinder Head Cover, Right (As Required)** |
| ** (1) | 5184596AE | Gasket, Cylinder Head Cover, Left (As Required)** |
| ** (1) | 68078604AA | Gasket Kit, Chain Case Cover** |
| (1) | 68082860AA | RTV, Threebond Engine |
| (1) | 68079744AC | Filter, Engine Oil |
| (AR) | 04761838AD | Oil, Engine |

REPAIR PROCEDURE:

1. Perform a cylinder leakage test on cylinders 2, 4 and 6. Follow the detailed service procedures available in DealerCONNECT/TechCONNECT, Refer To Group 9 - Engine, 3.6L> Diagnosis and Testing> Cylinder Leakage Test.
2. Do any of the cylinders exhibit leakage of 25% or greater?
 - a. If Yes>>> Proceed to Step 3.
 - b. If No>>> This bulletin does not apply. Proceed with normal diagnostic procedures.

NOTE: Record all cylinder leakage test results on the Repair Order.

3. Replace the left cylinder head. Follow the detailed service procedures available in DealerCONNECT/TechCONNECT, Refer To Group 9 - Engine, 3.6L> Cylinder Head> Removal/Installation.

POLICY:

Reimbursable within the provisions of the warranty.

NOTE: Vehicles included in this Service Bulletin have extended warranty coverage for this repair. See Warranty Bulletins; U.S. D-14-12, Canada SAB-2014-11, International ID-14-03, Puerto Rico/Virgin Islands ID-14-04 or Mexico BG-22-14 for details associated with the extended warranty.

TIME ALLOWANCE:

| Labor Operation No: | Description | Skill Category | Amount |
|----------------------------|--|-----------------------|---------------|
| 09-35-09-90 | Cylinder Leakage Test Only (3 - Highly Skilled) | 1 - Engine Repair | 1.0 Hrs. |
| 09-35-03-93 | Head, Cylinder Assembly - Replace Left/Front Side (Includes cylinder leakage test) (3 - Highly Skilled) LC/LD/LX | 1 - Engine Repair | 8.2 Hrs. |
| 09-35-03-93 | Head, Cylinder Assembly - Replace Left/Front Side (Includes cylinder leakage test) (3 - Highly Skilled) WD/WK | 1 - Engine Repair | 8.7 Hrs. |
| 09-35-03-93 | Head, Cylinder Assembly - Replace Left/Front Side (Includes cylinder leakage test) (3 - Highly Skilled) JK | 1 - Engine Repair | 9.0 Hrs. |
| 09-35-03-93 | Head, Cylinder Assembly - Replace Left/Front Side (Includes cylinder leakage test) (3 - Highly Skilled) JS/RT | 1 - Engine Repair | 9.8 Hrs. |
| 09-35-03-93 | Head, Cylinder Assembly - Replace Left/Front Side (Includes cylinder leakage test) (3 - Highly Skilled) JC | 1 - Engine Repair | 10.2 Hrs. |
| Opt. Operation No: | Description | | Amount |
| 09-35-03-94 | AWD Equipped LD/LX | 1 - Engine Repair | 0.8 Hrs. |
| 09-35-03-94 | 4X4/AWD Equipped WD/WK | 1 - Engine Repair | 1.6 Hrs. |
| 09-35-03-95 | Rear A/C Equipped JC | 1 - Engine Repair | 0.2 Hrs. |
| 09-35-03-96 | Air Suspension Equipped WK | 1 - Engine Repair | 0.3 Hrs. |

FAILURE CODE:

| | |
|----|----------------|
| ZZ | Service Action |
|----|----------------|