



**NUMBER:** 08-079-14 REV. B

**GROUP:** Electrical

**DATE:** October 24, 2014

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.*

**THIS BULLETIN SUPERSEDES TECHNICAL SERVICE BULLETIN 08-079-14 REV. A, DATED OCTOBER 10, 2014 WHICH SHOULD BE REMOVED FROM YOUR FILES. ALL REVISIONS ARE HIGHLIGHTED WITH \*\*ASTERISKS\*\* INCLUDES A NEW SYMPTOM/CONDITION.**

**THIS SERVICE BULLETIN IS ALSO BEING RELEASED AS RAPID RESPONSE TRANSMITTAL (RRT) 14-081. ALL APPLICABLE SOLD AND UN-SOLD RRT VIN'S HAVE BEEN LOADED. TO VERIFY THAT THIS RRT SERVICE ACTION IS APPLICABLE TO THE VEHICLE, USE VIP OR PERFORM A VIN SEARCH IN TECHCONNECT. ALL REPAIRS ARE REIMBURSABLE WITHIN THE PROVISIONS OF WARRANTY.**

***SUBJECT:***

RA3 RA4 Radio Update For Ignition Off Battery Draw

***OVERVIEW:***

This bulletin involves inspecting and, if required, updating the radio software.

***MODELS:***

2015	(WK)	Grand Cherokee (U.S. Market Only)
2015	(KL)	Cherokee (U.S. Market Only)
2015	(LA)	Challenger (U.S. Market Only)
2015	(ZD)	Viper (U.S. Market Only)
2015	(WD)	Durango (U.S. Market Only)

**NOTE: This bulletin applies to U.S. market vehicles only built on or before August 20, 2014 (MDH 0820XX) and equipped with one of the following radios:**

- Uconnect 8.4A AM/FM/BT/ACCESS (sales code RA3)
- Uconnect 8.4AN AM/FM/BT/ACCESS/NAV (sales code RA4)

***SYMPTOM/CONDITION:***

A small number of customers may experience a low battery condition due to the radio remaining powered up after the ignition has been turned off. \*\*Also the customer may notice when the radio is set to an SiriusXM station it may switch by itself to an AM station.\*\*

***DIAGNOSIS:***


Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available, verify the Audio system is operating properly. If Audio DTCs are present, record them on the repair order and repair as necessary before proceeding further with this bulletin.

If a customer's VIN is listed in VIP or your RRT VIN list, perform the repair. For all other customers that describe the symptom/condition, perform the Repair Procedure.

### REPAIR PROCEDURE:

**CAUTION: This software update is only compatible with the 2015 model year vehicles listed above. Attempting to flash a 2013-2014 model year vehicle with this software will result in a loss of some radio/navigation functions. Should this occur reinstalling the correct software for the radio will correct the condition.**

1. Has the USB flash drive been created?
  - a. Yes >>> Proceed to [Step #5](#).
  - b. No >>> Proceed to [Step #2](#).
2. Go to DealerCONNECT> Service> UCONNECT Information & Utilities> Uconnect Dealer software downloads to download the files.
3. If a security message appears "Do you want to view only the web page content that was delivered securely?" see ([Fig. 1](#)). Press **No** to continue.

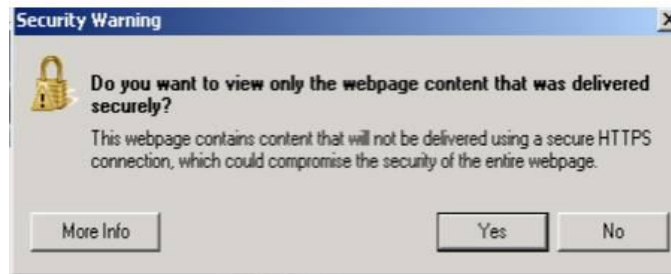

***Fig. 1 Pop-up Security Message***

**NOTE: A blank USB flash drive must be used to download the software. Only one software update can be used on one USB flash drive.**

**NOTE: If the dealer cannot download the software, make sure you have proper security access. If not, have the Service Manager or Shop Foreman download the software update.**

4. To download the software files to a USB flash drive, follow the on screen instructions and perform the following.
  - a. Acquire a blank USB flash drive with at least 4 gb of space.
  - b. Download the software update file to your local pc's desktop.
  - c. Be sure to extract the file before copying it to the blank USB flash drive.
  - d. A blank USB flash drive will be needed one for each radio update, additional updates can not be on the same USB flash drive.
  - e. Once the file is saved to the USB flash drive, it is recommended you physically label the USB flash drive with the bulletin number and proper radio sales codes.

**NOTE: The vehicle must be in Customer Mode to update the radio.**

5. Start the vehicle and check if it is still in ship mode. This will be displayed in the Electronic Vehicle Information Center (EVIC).
6. Is the vehicle in Ship Mode?
  - a. Yes >>> Proceed to [Step #7](#).
  - b. No >>> Proceed to [Step #8](#).
7. Press and hold the 'Enter/Browse' button and the 'Front Defrost' (about 5 seconds) until "Ship Mode" is no longer displayed on the instrument cluster, see ([Fig. 2](#)).



***Fig. 2 Take Vehicle Out of Ship Mode***

8. With the engine running and radio powered on, insert the **correct** USB flash drive with new software into USB port.
9. The next screen display will have the old and new software levels. The radio will be updated to 14.32.3.
10. Is the radio at software level 14.32.3 or higher?

- a. Yes>>> The radio software is already up to date. The bulletin is now complete. Use Labor Op 18-60-02-DB to close out the RRT portion of this bulletin.
- b. No>>> The radio software needs to be updated. Proceed to [Step #11](#).

**CAUTION: If the radio software level is at or above the level on the USB flash drive, DO NOT perform the update.**

11. Press the soft key “Yes” to start the update.

**NOTE: If the software update process is interrupted, aborted or failed, the process should be restarted.**

**NOTE: Do not cycle the ignition or touch the radio during the update process.**

12. The update may take up to 20 minutes to load. No other actions will be needed to initiate the update.
13. After the update is done, the screen will display the software levels again.
14. Press “No” and turn the vehicle off. Open and close the driver’s door and let the Bus go to sleep.

**NOTE: Make sure to leave ignition off, do not press the brake, and do not reopen any doors, so the modules will go to sleep.**

15. Cycle the ignition on, then back off one more time. Open and close the driver’s door and let the Bus go to sleep. This will complete the radio update.
16. Remove the USB flash drive, the bulletin is now complete.

**NOTE: If the vehicle needs to be put back into Ship Mode, press and hold the ‘Enter/Browse’ button and the ‘Front Defrost’ (about 5 seconds) until “Ship Mode” is displayed on the instrument cluster.**

***POLICY:***

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

<b>Labor Operation No:</b>	<b>Description</b>	<b>Skill Category</b>	<b>Amount</b>
18-60-02-DE	Radio, Software - Create USB flash drive, From CD or Uconnect Website (One Time Only) (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs
18-60-02-DB	Radio, Check Software Level Only (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs
18-60-02-DC	Radio, Check Software Level and, Perform Software Update (0 - Introduction)	6 - Electrical and Body Systems	0.4 Hrs.

**NOTE: The “One Time Only” LOP is used one time per dealer when downloading the software onto a USB flash drive. The dealer can only use the download LOP, one time for each of the radios listed.**

**NOTE: The expected completion time for the flash download portion of this procedure is approximately 25 minutes. Actual flash download times may be affected by vehicle connection and network capabilities.**

**FAILURE CODE:**

ZZ	Service Action
----	----------------