



STAR ONLINE PUBLICATION




Case Number: S2208000142

Release Date: July 2022

Symptom/Vehicle Issue: Air Bag Warning Lamp On

Owner Complaint/Technician Observation: Owner complains the air bag warning lamp is on after a recent vehicle repair service. Technician observed the module has a Diagnostic Trouble Code (DTC) **B0082-13 Passenger Seatbelt Load Limiter Deployment Control – Circuit Open.**

Repair Procedure: Inspect the pretensioner control circuit connector to ensure no pushed out or loose terminals. Secure the 4-way yellow connector at the passenger seat belt tensioner location and or repair the connector with the full connector repair kit 68490850AA.

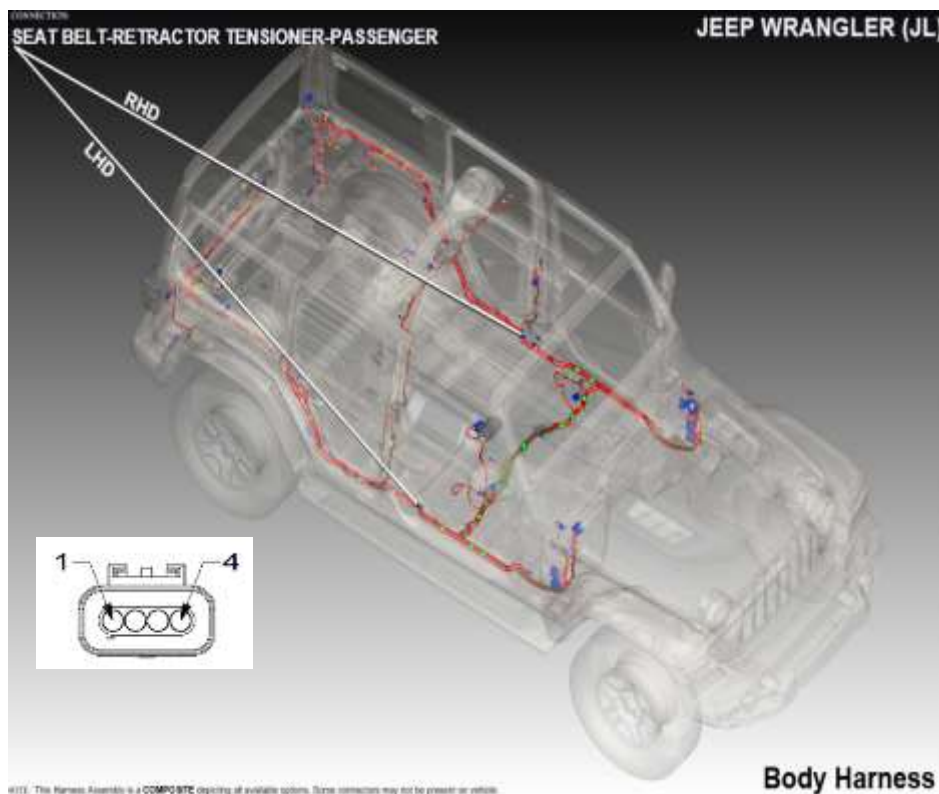

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found