

# Technical Service Bulletin



## 43 Warning light for the suspension control module

43 23 68 2059665/4 January 20, 2023. Supersedes Technical Service Bulletin Group 43 number 22-58 dated June 9, 2022, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4, A4 allroad, and Q7	2017 – 2023	All	Not Applicable
S4, A5, A5 Cabriolet, A5 Sportback, S5, S5 Cabriolet, S5 Sportback, Q5, and SQ5	2018 – 2023		
RS 5	2018 – 2019 2021 – 2023		
RS 5 Sportback	2019 2021 – 2023		
Q8	2019 – 2023		
SQ7, SQ8, and RS Q8	2020 – 20203		
Q5 e quattro, Q5 Sportback, and SQ5 Sportback	2021 - 2023		

## Condition

REVISION HISTORY		
Revision	Date	Purpose
4	-	Revised <i>Service</i> (Updated Step 3)
3	06/09/2022	Revised <i>header</i> (Added Models and model years) Revised <i>Service</i> (Updated SVM table)
2	06/04/2021	Revised <i>header</i> (Added model year) Revised <i>Warranty</i> (Added Claim Types)

**Customer states:**



- The warning light for the suspension comes on in the instrument cluster.

## Workshop findings:

- When carrying out "Check control unit configuration", the software version management (SVM) registers an unknown event. The suspension control module, J775 (address word 0074) can therefore not be automatically parametrized.

## Technical Background

Not applicable.

## Production Solution

Not applicable.

## Service

### SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the suspension control module, J775 (address word 0074) using the SVM action code as listed in the table below, if necessary:

Model	New Software Version (or higher)	New ZDC Version	SVM Code Input
A4 ,A5, Q5, Q7, Q8	1215	8W0909576VC	<b>74A005</b>

3. After the software update, proceed with a new "basic settings complete" process of the suspension control module J775.

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"><li>• 110 up to 48 Months/50,000 Miles.</li><li>• G10 for CPO Covered Vehicles – Verify Owner.</li><li>• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li></ul>
<b>Service Number:</b>	4316
<b>Damage Code:</b>	0039

# Technical Service Bulletin



<b>Labor Operations:</b>	Software Update (Includes checking for DTCs)	0151 0000	Time stated on the diagnostic protocol (Max 40 TU)
<b>Diagnostic Time:</b>	GFF	No allowance	0 TU
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	0121 0004	10 TU
<b>Claim Comment:</b>	As per TSB 2059665/4		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions*.

All part and service references provided in this TSB (**2059665**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.