

Reference	SSM75927
Models	Discovery Sport / L550 (325848 → 889508) New Range Rover Evoque / L551 (207364 → 134346)
Title	22-23MY 9HP Auto Transmission/Electrical Harness fixing bolt Incorrect length.
Category	Driveline
Last modified	23-Jan-2023 00:00:00
Symptom	501000 Automatic Transmission Concerns
Attachments	Attachment24.pdf (Attachment24.pdf)

Content

Issue:
A customer may complain of a transmission noise at low speeds.

Cause:
An incorrect bolt length may have been fitted during production, securing a wiring harness to the AJ21-D4 & AJ21-P4 9HP transmission.

Action:
Inspect and check or when replacing the 9HP transmission the length of the bolt in question (In attachment). If bolt length is 40mm, discard bolt and replace with correct 25mm long bolt. If bolt length is 25mm, reuse existing bolt. (Fixing part number: FS108256 available in EPC).

anBhdHRicnM7MjAyMy0wMS0yM1QxOToxNj00My4wOTdaOzEzNi4yMjYyNTluODE7