



Preliminary Information

PIP5896 Service Engine Soon Light/Message with DTCs P1967 or P1968 in the TCM

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Corvette	2023	All	All	All	M1L, M1M

Involved Region or Country	North America
Condition	Service engine tell-tale or message with stored TCM DTCs or P1967 and or P1968
Cause	TCM Software anomaly

Some customers may comment on a service engine telltale, reduced engine power message with no noticeable performance issues.

When scanning the vehicle for DTCs the technician may find P0700 stored in the ECM and P1967 or P1968 stored in the TCM.

If there are other DTC in the TCM diagnose those first as per service information.

If only DTCs P1967 or P1968 are set, it may be caused by a software anomaly and revised TCM software is scheduled for release in the first quarter of 2023.

Until then Clear the DTC and perform transmission diagnostic service test.

If transmission diagnostic service test passes that would indicate the trans is fine and no further repairs should be attempted.

When the software is available it will go to the vehicle as part of an Over the Air update.

TCM should not be replaced for P1967 or P1968.

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
8468822	Transmission Service Diagnostic Test	Use Published Labor Time

Version History

Version	1
Modified	01/06/2023 - Created on.



GENERAL MOTORS

© 2023 General Motors. All Rights Reserved.