

# **Preliminary Information**

## PIT5949A Overhead Roof Console Inoperative / Service Safety Restraints Message / Sunroof Inoperative / Dome Lights Inoperative / DTCs B1A7A and U1121

#### **Models**

| Brand:    | Model:          | Model Years: | VIN: |     | Engine: | Transmissions:   |
|-----------|-----------------|--------------|------|-----|---------|------------------|
|           |                 |              | from | to  | Engine. | Halisillissions. |
| Cadillac  | Escalade Models | 2021 - 2023  | All  | All | All     | All              |
| Chevrolet | Suburban        | 2021 - 2023  | All  | All | All     | All              |
| Chevrolet | Tahoe           | 2021 - 2023  | All  | All | All     | All              |
| GMC       | Yukon Models    | 2021 - 2023  | All  | All | All     | All              |

| Involved Region or Country | North America  |
|----------------------------|--|
|                            | In some rare cases, a customer may comment at start up that their vehicle has the following symptoms:  |
|                            | - Service Safety Restraints System Message   |
|                            | - Sunroof Inoperative  |
|                            | - Sunshade Lights Inoperative  |
|                            | - Dome Lights Inoperative  |
|                            | - Power Liftgate Inoperative when using switch in overhead console   |
|                            | - DTCs U1121 set in the BCM and B1A7A set in the Restraints Module   |
| Condition                  | During the condition, if one of the overhead roof console dome/map lights is cycled on/off then all functions will return to normal operation for the entire ignition cycle. |
|                            | Important: Even when all other overhead roof console functions are inoperative, the Onstar button / LED will still be operational.   |
|                            | Note: For the 2021 model year vehicles, please be aware of PIT5774F which has a  |
|                            | similar condition, but the conditions listed in that PI do not recover functionality if the dome/map light switch is cycled on/off.  |
| Cause                      | Unknown  |

#### **Correction:**

GM Engineering is working on a fix. In the meantime, if this condition occurs please ask the customer to cycle one of the overhead roof console dome/map lights on/off. This will correct the concerns for that ignition cycle.

#### **Warranty Information**

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage

#### information.

| Labor<br>Operation | Description   | Labor Time                    |
|--------------------|---|-------------------------------|
| 0540459            | Interior Overhead Systems - Customer Concern Not Duplicated | Use Published Labor Operation |
|                    | (CCND)  | Time                          |

### <u>Version History</u>

| Version  | 2  |
|----------|--|
| Modified | 09/27/2022 - Created on.                     |
| Modified | 01/25/2023 - Updates to the Warranty Section |



 $\hbox{@ 2023}$  General Motors. All Rights Reserved.